

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:

401488822

Date Received:

12/18/2017

FIR RESOLUTION FORM

CA Summary:

1 of 1 CAs from the FIR responded to on this Form

1 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 8667
Name of Operator: PETROGLYPH OPERATING CO INC ADBA PETROGLYPH ENERGY
Address: 960 BROADWAY AVE SUITE 500
City: BOISE State: ID Zip: 83706

Contact Name and Telephone:
Name: _____
Phone: () Fax: ()
Email: _____

Additional Operator Contact:

Contact Name	Phone	Email
Freese, Steve		steve.freese@state.co.us
COLBY, NICOLE		ncolby@pgei.com
POWELL, PAUL		ppowell@pgei.com

COGCC INSPECTION SUMMARY:

FIR Document Number: 689900298
Inspection Date: 10/18/2017 FIR Submit Date: 10/31/2017 FIR Status: _____

Inspected Operator Information:

Company Name: PETROGLYPH OPERATING CO INC ADBA PETROGLYPH ENERGY Company Number: 8667
Address: 960 BROADWAY AVE SUITE 500
City: BOISE State: ID Zip: 83706

LOCATION - Location ID: 324518

Location Name: STATE-628S67W Number: 36NESW County: HUERFANO
Qtrqtr: NESW Sec: 36 Twp: 28S Range: 67W Meridian: 6
Latitude: 37.564380 Longitude: -104.843494

FACILITY - API Number: 05-055-00 Facility ID: 211917

Facility Name: STATE Number: 36-11
Qtrqtr: NESW Sec: 36 Twp: 28S Range: 67W Meridian: 6
Latitude: 37.564380 Longitude: -104.843494

CORRECTIVE ACTIIONS:

1 CA# 108875

Corrective Action: Install or repair required BMPs per Rule 1002.f. Date: 12/15/2017

Response: CA COMPLETED Date of Completion: 12/12/2017

In response to Corrective Action resulting from inspection dated 10/18/2017, Petroglyph Operating Company, Inc.'s environmental contractor performed road maintenance and stabilization during the period December 4 through 12, 2017. Road maintenance was performed on the section of road from County Road 342 to well pad

Operator Comment: State 36-11. Road maintenance involved ripping the surface to remove ruts and erosion features. The road was then graded to create positive drainage from the road surface through either crowning or sloping to the downhill side. Borrow ditches were repaired/maintained to ensure positive drainage.

Previously installed water bars were reinforced with existing road materials to ensure proper function during stormwater runoff events. Additional water bars were placed where drainage patterns suggested additional stormwater runoff control was needed. The outlets of water bars were shaped and graded to allow stormwater runoff to effectively drain from the road ditches.

Maintenance was performed on borrow ditches along the road. This consisted of repair, grading and shaping, and construction of loose-rock check dams, where necessary. In addition, ditch turn outs were maintained and constructed to reduce stormwater runoff volumes in borrow ditch segments.

Photographs and a map are included as an attachment to this submittal, with the yellow dot on the map indicating installation of waterbars Nos. 2 through 21.

COGCC Decision: Approved pending re-inspection

COGCC Representative:

[Empty box for COGCC Representative signature]

OPERATOR COMMENT AND SUBMITTAL

Comment: Please see Corrective Action detail in the prior tab.

[Empty box for comment details]

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Nicole Colby

Signed: _____

Title: Mgr, Land & Reg Compl

Date: 12/18/2017 7:00:14 AM

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

<u>Document Number</u>	<u>Description</u>
401488822	FIR RESOLUTION SUBMITTED
401488829	2017-12-12 Attachment A: POCI Erosion Control / Road Maintenance (36-11)

Total Attach: 2 Files