

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

12/19/2017

Submitted Date:

12/19/2017

Document Number:

677400258**FIELD INSPECTION FORM**
 Loc ID 319272 Inspector Name: MONTOYA, JOHN On-Site Inspection ☐ 2A Doc Num: _____
Operator Information:OGCC Operator Number: 46290Name of Operator: K P KAUFFMAN COMPANY INCAddress: 1675 BROADWAY, STE 2800City: DENVER State: CO Zip: 80202**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**7 Number of Comments4 Number of Corrective Actions☒ Corrective Action Response Requested**Contact Information:**

Contact Name	Phone	Email	Comment
,		cogcc@kpk.com	All Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
243195	WELL	SI	10/01/2017	GW	123-10986	Ringsby 1	SI

General Comment:

LocationOverall Good: ☒**Signs/Marker:**

Type	CONTAINERS		
Comment:			
Corrective Action:		Date:	
Type	BATTERY		
Comment:			
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment: Corrective Action: Date: Overall Good: ☒**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Equipment:**

Type: Horizontal Heated Separator	#		corrective date
Comment:			
Corrective Action:		Date:	
Type: Bird Protectors	# 3		
Comment:			
Corrective Action:		Date:	
Type: Plunger Lift	# 1		
Comment:			
Corrective Action:		Date:	
Type: Gas Meter Run	# 3		
Comment:			
Corrective Action:		Date:	

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	<50 BBLS	CONCRETE SUMP/VAULT		,
Comment:	25 bbl capacity concrete vault berms in dis-repair				

Corrective Action:	Location is within an exception zone, repair or install berms or other secondary containment devices per Rule 604.c.(3)B.	Date:	01/03/2018
--------------------	---	-------	------------

Paint

Condition	Adequate
Other (Content)	
Other (Capacity)	
Other (Type)	

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Inadequate	Walls Insufficient	Base Insufficient	Inadequate
Comment:	berms in dis-repair			
Corrective Action:	Location is within an exception zone, repair or install berms or other secondary containment devices per Rule 604.c.(3)B.			Date: 01/03/2018

Contents	#	Capacity	Type	Tank ID	SE GPS
CRUDE OIL	1	300 BBLs	STEEL AST		40.043110,-104.365860
Comment:	berms in dis-repair				
Corrective Action:	Location is within an exception zone, repair or install berms or other secondary containment devices per Rule 604.c.(3)B.				Date: 01/03/2018

Paint

Condition	Adequate
Other (Content)	
Other (Capacity)	
Other (Type)	

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Inadequate	Walls Insufficient	Base Insufficient	Inadequate
Comment:	Berms in dis-repair			
Corrective Action:	Location is within an exception zone, repair or install berms or other secondary containment devices per Rule 604.c.(3)B.			Date: 01/03/2018

Venting:

Yes/No	NO
Comment:	
Corrective Action:	Date:

Flaring:

Type	
Comment:	
Corrective Action:	Date:

Inspected FacilitiesFacility ID: 243195 Type: WELL API Number: 123-10986 Status: SI Insp. Status: SI**Idle Well**Purpose: ☒ Shut In ☐ Temporarily Abandoned

Reminder: _____

Comment: _____

Corrective Action: _____

Date: _____

COGCC Comments

Comment	User	Date
2" riser by prod oil tank needs to be marked and tested	montoyaj	12/19/2017

Attached DocumentsYou can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
401491204	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4330826
677400260	berms in dis-repair and prodequipment	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4330825