

# Interim Reclamation and Stormwater Inspection

January 3, 2018

Operator: LONGS PEAK RESOURCES LLC- #10611

Location ID: 438066

Weld County, CO

NENW Section 28 T12N R66W

Chris Binschus  
Reclamation Specialist, COGCC



**COLORADO**  
Oil & Gas Conservation  
Commission

Department of Natural Resources

Inspection Photos  
Location Name: LAZY D ZN #03-15HZ  
Location ID: 438066



**Photo 1.** Photo taken from the southwestern location, facing West. Operator has not constructed the berm BMP with good engineering practices per Rule 1002.f.(2)., nor has the Operator repaired the berm BMP from the previous corrective action inspection.



**Photo 2.** Photo taken from the southwestern location, facing East. See comments under Photo 1.

Inspection Photos  
Location Name: LAZY D ZN #03-15HZ  
Location ID: 438066



**Photo 3.** Photo taken from the southwestern location, facing North. Operator has haphazardly installed rock material that appears to be used as a berm BMP and a stabilized outfall to the lower perimeter ditch and berm BMP.



**Photo 4.** Photo taken from the southwestern location, facing East. Operator has constructed a ditch and berm BMP; however, there is sediment blocking the path that will not allow stormwater flows to travel to the sediment trap. Ditch BMP in need of maintenance.



Inspection Photos  
Location Name: LAZY D ZN #03-15HZ  
Location ID: 438066



**Photo 5.** Photo taken from the southwestern location, facing West. Operator has not constructed the ditch and berm BMP with good engineering practices. Ditch BMP in need of maintenance.



**Photo 6.** Photo taken from the western sediment trap, facing West. Appears the Operator has made improvements to the sediment trap (enlarged the depth and improved the embankment berms). Inlet protection to the sediment trap has not been installed to good engineering practices. Appears the outfall of the sediment trap is higher than the ditches; therefore, the sediment trap would not properly function.

Inspection Photos  
Location Name: LAZY D ZN #03-15HZ  
Location ID: 438066



**Photo 7.** Photo taken from the eastern location, facing East. See comments under Photo 6.



**Photo 8.** Photo taken from the eastern location, facing South. Remove unused equipment per Rule 603.f.



Inspection Photos  
Location Name: LAZY D ZN #03-15HZ  
Location ID: 438066



**Photo 9.** Photo taken from the eastern location, facing North. See comments under Photo 8.

Inspection Photos  
Location Name: LAZY D ZN #03-15HZ  
Location ID: 438066



**Photo 10.** Photo taken from the northern cut slope area, facing West on January 3, 2018. Operator has not properly installed the erosion blanket using good engineering practices and has not addressed the issue since the previous inspection. Operator has not properly trenched and anchored BMP. Operator has not installed the BMP with good contact with the ground to avoid tenting.



**Photo 11.** Photo taken from the northern cut slope area, facing East on October 6, 2017. Photo illustrates the Operator has not addressed the issue to properly install the erosion blanket.