

# Interim Reclamation and Stormwater Inspection

January 12, 2018

Operator: BARRETT CORPORATION\* BILL - #10071

Location ID: 452695

Inspection Document #: 682403211

Weld County, CO

NWSW Section 27 T5N R61W

Chris Binschus  
Reclamation Specialist, COGCC



**COLORADO**  
Oil & Gas Conservation  
Commission

Department of Natural Resources

**Inspection Photos**  
**Location Name: Anschutz-Williams /5-61-27 CW2**  
**Location ID: 452695**



**Photo 1.** Photo taken from one of the wellheads at location. Photo illustrates a rat hole left open. This is a potential safety and wildlife hazard. Operator should also consider placing safety fence around the wellhead area for safety measures.



**Photo 2.** Photo taken from an adjacent wellhead at location. Photo illustrates the rat hole was partially covered up.



**Inspection Photos**  
**Location Name: Anschutz-Williams /5-61-27 CW2**  
**Location ID: 452695**



**Photo 3.** Photo taken from the wellhead area, facing East. Operator has left drill cuttings at location and has not properly transported the drill cuttings off location.



**Photo 4.** Photo taken from the eastern well pad, facing South. Operator needs to properly store or remove sawdust from location.

**Inspection Photos**  
**Location Name: Anschutz-Williams /5-61-27 CW2**  
**Location ID: 452695**



**Photo 5.** Photo taken from the western perimeter of the location, facing North. Straw wattle BMP has been installed and hydromulch has been applied to unconsolidated soil material along the perimeter of the location.



**Photo 6.** Photo taken from the northern perimeter of the location, facing East. Appears a surface roughening BMP has been installed along portions of the perimeter; however, this does not appear to be a sufficient and appropriate BMP for the sandy soil conditions. Hydromulch has been applied to unconsolidated soil material along the perimeter of the location.



## Inspection Photos

Location Name: Anschutz-Williams /5-61-27 CW2

Location ID: 452695



**Photo 7.** Photo taken from the northern location, facing South. Operator shall keep the trash lid closed to prevent trash from blowing out of containment.



**Photo 8.** Photo taken from the eastern perimeter of the location, facing South. Appears the Operator has temporarily stabilized the topsoil stockpile with hydromulch. Operator does not have sufficient stormwater BMPs along the perimeter of the location.

## Inspection Photos

Location Name: Anschutz-Williams /5-61-27 CW2

Location ID: 452695



**Photo 9.** Photo taken from the southeastern perimeter of the location, facing West. Operator has not properly stabilized the berm BMP.



**Photo 10.** Photo taken from the southern perimeter of the location, facing North. Operator has not sufficiently stabilized the southern fill slope.