

Interim Reclamation and Stormwater Inspection

February 14, 2018

Operator: EXTRACTION OIL & GAS LLC- #10459

Location ID: 439079

Inspection Document #: 682403324

Weld County, CO

NENE Section 18 T4N R68W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos

Location Name: Kennedy /18-D Pad

Location ID: 439079



Google Earth aerial photo taken October 14, 2017 of the Kennedy Pad, totaling 8.03 acres of construction disturbance. This is the current state of total disturbance observed on February 14, 2018. Operator has failed to perform interim reclamation by the required date.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Aerial imagery illustrates the approximate photograph location taken during the February 14, 2018 inspection.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Photo 1. Photo taken from the western sediment basin, facing South. Operator has installed a sediment basin increasing the sediment storage area. However, Operator has not constructed to the sediment basin per the Stormwater Technical Drainage Analysis Memo.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Photo 2. Photo taken from the western sediment basin spillway, facing North. See comments under Photo 1. Operator has not installed a riser pipe and the spillway has not been constructed with riprap.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Photo 3. Photo taken from the southeast sediment basin, facing North. See comments under Photo 1.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Photo 4. Photo taken from the southeast sediment basin spillway, facing Southwest. See comments under Photo 2.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Photo 5. Photo taken from the topsoil stockpile, facing East. Operator has failed to prevent weed establishment on the topsoil stockpile per Rule 1002.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Photo 6. Photo taken from the northeastern location, facing East. Operator has not properly stabilized the cut slope which is susceptible to erosion.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Photo 7. Photo taken from the northeastern location, facing West. Operator has failed to perform interim reclamation per Rule 1003.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Photo 8. Photo taken from the western location, facing South. Operator is storing equipment in areas that should be reclaimed per Rule 1003.



Photo 9. Photo taken from the western location, facing North. See comments under Photo 8.

Inspection Photos
Location Name: Kennedy /18-D Pad
Location ID: 439079



Photo 10. Photo taken from the western location, facing East. Operator has improperly tracked the western side slopes. Equipment tracking should be tracked perpendicular to the slope.