

On April 18, 2018, COGCC Environmental Staff (Alex Fischer) conducted an environmental field inspection of SandRidge Exploration & Production LLC's (SandRidge) Surprise 4-06H and Damfino 2-06H Location (Location ID: 416625) API 057-06480 and 057-06482. Weather was sunny and temperatures about 25 degrees Fahrenheit.

The following is a summary:

- Oil staining on ground near the Surprise and Damfino well heads.
- Oil staining beneath 90 degree elbow and valve on Tank # 3947. Insulation appears to be oil saturated (historic or current?).
- Valve on Tank #3947 and Tank # 3944 maybe weeping oil.
- Lid to the "oil" catchment containment is broken and secured with two rocks.
- Trash and debris on location (oily rag within tank battery berm NE corner).
- Approximately 5-8 yards of soil on liner in the NW corner of Location.

**Corrective Actions (CAs):**

- **By April 30, 2018**, remove trash/debris. Comply with Rule 603.f using the Rule 603.f guidance document for further details.
- **By May 20, 2018**, remediate the oily stains and salty stains beneath catchment containments, valves, fittings, and unions at well head and pump jack.

*906.a, Spills/Releases, Control and contain spills/releases and clean up per Rule 906.a. Contact COGCC EPS staff., Immediately to stop and clean up 24 hours to remove free fluids. 30-days to remove stained soil.*

Train and educate staff and contract personnel on house keeping with zero spills within the load out areas, and that staining beneath valves, fittings, unions, etc. may be a result of leaking/loose/weeping valves, fitting, unions, etc. that should immediately be addressed.

Provide description and source of the 5-8 yards of soil on liner.