

Stormwater Inspection

April 20, 2018

Operator: PETROSHARE CORPORATION- 10454

API: 05-039-06553

Inspection Document #: 682403501

Elbert County, CO

NENE Section 20 T6S R64W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos
Location Name: NORDMAN TRUST #41-20
API: 05-039-06553



Photo 1. Photo taken from the northeast well pad on November 3, 2017, facing East. Rip-rap has been installed but does not appear to be a sufficient BMP as active gully erosion is evident. Operator needs to repair gully erosion and install sufficient BMPs.



Photo 2. Photo taken from the northeast well pad on April 20, 2018, facing East. Operator made repairs to the gully erosion and installed additional BMPs (i.e., more rip-rap and straw bales).

Inspection Photos
Location Name: NORDMAN TRUST #41-20
API: 05-039-06553



Photo 3. Photo taken downgradient from the gully erosion on November 3, 2017, facing West. See comments under Photo 1.



Photo 4. Photo taken downgradient from the gully erosion on April 20, 2018, facing West. See comments under Photo 2.

Inspection Photos
Location Name: NORDMAN TRUST #41-20
API: 05-039-06553



Photo 5. Photo taken from the western well pad location on November 3, 2017, facing West. Appears stormwater run-on onto the location is causing gully erosion along the western cut slope which is causing degradation to the location. Operator needs to repair gully erosion and install sufficient BMPs.



Photo 6. Photo taken from the western well pad location on April 20, 2018, facing West. Operator made repairs to the gully erosion and installed additional BMPs (i.e, more rip-rap, straw bales and surface roughening).

Inspection Photos
Location Name: NORDMAN TRUST #41-20
API: 05-039-06553



Photo 7. Photo taken from a portion of the access road on November 3, 2017, facing South. Rill erosion forming into gully erosion is evident along the access road. Operator needs to repair erosion and install sufficient BMPs.



Photo 8. Photo taken from a portion of the access road on April 20, 2018, facing South. Operator made repairs and installed BMPs (i.e, straw bales and surface roughening).