

Interim Reclamation Inspection

May 14, 2018

Operator: KERR MCGEE OIL & GAS ONSHORE LP- #47120

Location ID: 441199

Inspection Document #: 682403586

Weld County, CO

SENE Section 26 T4N R68W

Chris Binschus
Reclamation Specialist, COGCC




COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos

Location Name: WILSON RANCH /5C-27HZ

Location ID: 441199

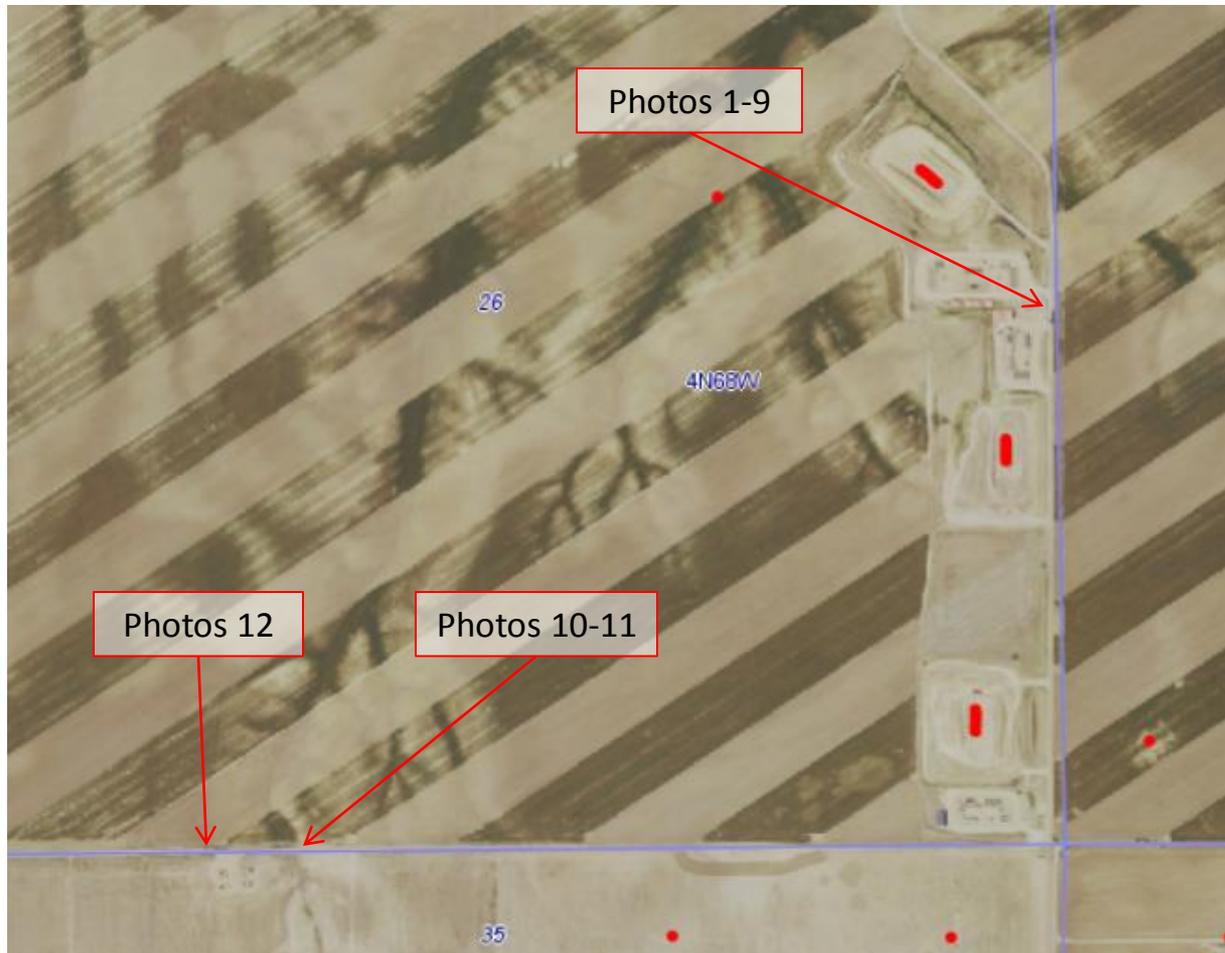

Aerial imagery to help illustrate the approximate photo locations during this inspection.

Inspection Photos

Location Name: WILSON RANCH /5C-27HZ

Location ID: 441199



Photo 1. Photo taken of the northeast battery location, facing North. Appears stormwater runoff from the battery location is causing rill erosion off location and impacting interim areas.

Inspection Photos

Location Name: WILSON RANCH /5C-27HZ

Location ID: 441199



Photo 2. Photo taken north of the well location, facing South. Appears stormwater runoff from the well location is causing rill erosion off location.

Inspection Photos
Location Name: WILSON RANCH /5C-27HZ
Location ID: 441199



Photo 3. Photo taken of the northeast battery location, facing West. Appears the Operator has performed interim reclamation activities to reduce disturbance areas only needed for production operations, with the evidence of drilling rows and straw crimped mulch. Operator shall continue to monitor and manage this site until the location meets Rule 1003 standards.



Photo 4. Photo taken of the northwest well location, facing North. See comments under Photo 3.

Inspection Photos
Location Name: WILSON RANCH /5C-27HZ
Location ID: 441199



Photo 5. Photo taken of the northwest well location, facing South. Rill erosion evident along portions of the northeastern well location and along the access road.



Photo 6. Photo taken of the northwest well location, facing East. See comments under Photo 3.

Inspection Photos

Location Name: WILSON RANCH /5C-27HZ

Location ID: 441199



Photo 7. Photo taken from the entrance of the location, facing North. Appears the outlet protection BMP for the culvert is not properly functioning to minimize rill erosion along the eastern perimeter of the location.

Inspection Photos

Location Name: WILSON RANCH /5C-27HZ

Location ID: 441199



Photo 8. Photo taken from a portion of the sediment accumulation caused by rill erosion, facing South.

Inspection Photos

Location Name: WILSON RANCH /5C-27HZ

Location ID: 441199



Photo 9. Photo taken from the east side of the access road, facing South. Photo illustrate sediment accumulation from rill erosion along the access road. There were no observed BMPs being implemented along the access road to minimize erosion.

Inspection Photos
Location Name: WILSON RANCH /5C-27HZ
Location ID: 441199



Photo 10. Photo taken from a portion of the access road, facing North. Approximate location in lat/long (40.277356, -104.973795). Rill erosion evident beyond the outlet protection of the culvert. Outlet protection in need of maintenance.



Photo 11. Photo taken from the opposite side of the access road, facing East. Rill erosion evident along portions of the access road. There were no observed BMPs being implemented along the access road to minimize erosion.

Inspection Photos

Location Name: WILSON RANCH /5C-27HZ

Location ID: 441199



Photo 12. Photo taken from a portion of the access road. Cattle guard in need of maintenance. A similar inspection will be sent to the other Operator that also uses this BMP and access road. Both Operator's will need to coordinate to perform the required maintenance for this BMP.