

FORM  
6Rev  
05/18

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401579211

Date Received:

03/19/2018

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: CHERYL LIGHT

Name of Operator: KERR MCGEE OIL &amp; GAS ONSHORE LP

Phone: (720) 929-6461

Address: P O BOX 173779

Fax: (720) 929-7461

City: DENVER State: CO Zip: 80217-

Email: cheryl.light@anadarko.com

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

API Number 05-123-24192-00

Well Name: REYNOLDS

Well Number: 7-23

Location: QtrQtr: SWNE Section: 23 Township: 3N Range: 68W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.215180

Longitude: -104.966910

GPS Data:

Date of Measurement: 02/27/2007

PDOP Reading: 2.8

GPS Instrument Operator's Name: STEVE FISHER

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 855

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7418	7438			
NIOBRARA	7168	7284			

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	753	570	753	0	VISU
1ST	7+7/8	4+1/2	11.6	7,561	542	7,561	2,010	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7090 with 25 sacks cmt on top. CIPB #2: Depth 3980 with 2 sacks cmt on top.  
CIBP #3: Depth 80 with 25 sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 25 sks cmt from 7090 ft. to 6740 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 140 sacks half in. half out surface casing from 955 ft. to 703 ft. Plug Tagged: ☒

Set 25 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CHERYL LIGHT

Title: SR REGULATORY ANALYST Date: 3/19/2018 Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: McCoy, Diane Date: 7/10/2018

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: 1/9/2019

<b>COA Type</b>	<b>Description</b>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Properly abandon flowlines per Rule 1105. File electronic Form 42 once abandonment complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line the operator must submit a Flowline Report, Form 44.</p> <p>3) Operator shall implement measures to control unnecessary and excessive venting, to protect the health and safety of the public, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.</p> <p>4) Production casing stub plug is also surface casing shoe plug, this plug must be tagged at 703' or shallower. Leave at least 100' of cement in the wellbore for each plug.</p>
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p>
	Operator to submit Form 7 reporting for Aug 2013, Oct 2016

### **Attachment Check List**

<b><u>Att Doc Num</u></b>	<b><u>Name</u></b>
401579211	FORM 6 INTENT SUBMITTED
401579273	PROPOSED PLUGGING PROCEDURE
401579275	WELLBORE DIAGRAM

Total Attach: 3 Files

### **General Comments**

<b><u>User Group</u></b>	<b><u>Comment</u></b>	<b><u>Comment Date</u></b>
Engineer	<p>Corrected cement top for first string. Added sacks of cement details for both surface and first strings.</p> <p>Added Codell perforations to zones section and corrected Niobrara bottom perf. depth. Wellbore diagram has perforations incorrectly labeled as Niobrara only but there are Niobrara and Codell perms.</p>	07/10/2018
Permit	<p>Verified as-drilled GPS data on COGIS map and well info</p> <p>Verified Drilling Completion Report doc #1832033</p> <p>Completed Interval Report doc #1832034 supports CODL perms 7418'-7438'</p> <p>Completed Interval Report doc #400249747 supports NBRR perms 7168'-7284'</p> <p>Form 7 reporting missing Aug 2013, Oct 2016</p>	04/18/2018
Public Room	Pass	03/20/2018

Total: 3 comment(s)