

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

09/07/2018

Submitted Date:

09/07/2018

Document Number:

689801626**FIELD INSPECTION FORM**Loc ID 424294 Inspector Name: Waldron, Emily On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**OGCC Operator Number: 10339Name of Operator: GULFPORT ENERGY CORPORATIONAddress: 14313 N. MAY AVENUE - SUITE 100City: OKLAHOMA CITY State: OK Zip: 73134**Status Summary:**

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☐ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:8 Number of Comments2 Number of Corrective Actions☒ Corrective Action Response Requested**Contact Information:**

Contact Name	Phone	Email	Comment
Kellerby, Shaun		shaun.kellerby@state.co.us	
Leonard, Mike		mike.leonard@state.co.us	
Seal, Jeff		jseaj@gulfportenergy.com	EHS Director; All Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
424295	WELL	PR	03/02/2012	OW	081-07666	ELLGEN 11-10-1	PR

General Comment:Routine FIU inspection in response to fire on 9/6/2018.

LocationOverall Good: ☒

Signs/Marker:			
Type	BATTERY		
Comment:			
Corrective Action:			Date:
Type	WELLHEAD		
Comment:			
Corrective Action:			Date:
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:			Date:

Emergency Contact Number:

Comment: 970-216-9119 is cell number for pumper. Emergency number listed on location signs no longer is manned 24/7. Stickers with this new number have been ordered and will be placed on location upon receipt.

Corrective Action: Install sign to comply with Rule 210.

Date: 10/08/2018

Overall Good: ☒

Spills:			
Type	Area	Volume	
Condensate	Treater	<= 1 bbl	
Comment:	Stained gravel around base of combustor. Operator plans to remove and properly dispose of all stained gravel and soil.		
Corrective Action:	Control and contain spills/releases and clean up per Rule 906.a. Contact COGCC EPS staff.		Date: 10/08/2018

In Containment: No

Comment: ☐ Multiple Spills and Releases?

Fencing/:			
Type	TANK BATTERY		
Comment:			
Corrective Action:			Date:
Type	PUMP JACK		
Comment:			
Corrective Action:			Date:
Type	SEPARATOR		
Comment:			
Corrective Action:			Date:
Type	WELLHEAD		
Comment:			
Corrective Action:			Date:

Equipment:				corrective date
Type: Emission Control Device	# 1			
Comment:	Fire was caused when back pressure control valve for the heater treater, which was located on the line to the combustor, failed, allowing condensate to be blown towards ignitor. Operator intends to remove valve from proximity to combustor and use methanol for control instead.			
Corrective Action:				Date:
Type: Vertical Heater Treater	# 1			
Comment:				
Corrective Action:				Date:
Type: Bird Protectors	#			
Comment:				
Corrective Action:				Date:
Type: Pump Jack	# 1			
Comment:				
Corrective Action:				Date:

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	400 BBLS	STEEL AST		40.497340,-107.598010
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Adequate			Adequate
Comment:				
Corrective Action:				Date:

Contents	#	Capacity	Type	Tank ID	SE GPS
CRUDE OIL	2	400 BBLS	STEEL AST		,
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance	
Earth	Adequate			Adequate	
Comment:					
Corrective Action:				Date:	

Venting:

Yes/No	NO		
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities									
Facility ID:	424295	Type:	WELL	API Number:	081-07666	Status:	PR	Insp. Status:	PR
Producing Well									
Comment:	Pumping.								
Corrective Action:				Date:					

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
		Compaction	Pass			
Gravel	Pass					
Berms	Pass					
Compaction	Pass					
		Gravel	Pass			
		Ditches	Pass			

Comment: Corrective Action: Date: **Pits:** ☐ NO SURFACE INDICATION OF PIT**COGCC Comments**

Comment	User	Date
Inspector on location in response to phone call received at 7:30 AM 9/7/2018 to notify COGCC of fire caused by equipment failure, resulting in 6.1 acre burn of vegetation on private land immediately adjacent to the location. The fire was caused when back pressure control valve for the heater treater, which was located on the line to the combustor, failed, allowing condensate to be blown towards ignitor. Dried vegetation on location perimeter caught on fire and was extinguished by local fire department.	waldrone	09/07/2018

Attached DocumentsYou can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
689801627	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4573337