

Summary of Re-entry and Re-plugging Operations for Strasser #1-27

1. Survey and locate plugged wellbore. Set a stake and record as-drilled GPS coordinates.
2. Excavate around wellbore to expose the top of the surface casing.
3. Cut existing cap off wellbore. Weld a slip collar to 9-5/8" casing and necessary length of casing to reach ground level. Weld another 9-5/8" slip collar.
4. Install wellhead and BOP.
5. Drill out existing cement plugs with 6-1/2" bit. If surface plug is tagged inside surface casing, pressure test surface casing to 250 psi before drilling out surface casing plug. Continue drilling or RIH to tag existing plug at ~6253'.
6. Spot cement plug from 6253'-5990' with class G cement (86 sks). Tag plug once set.
7. Spot plug from 700' to surface with class G cement (268 sks).
8. Cut off casing 5' below surface and weld on a cap to seal the well.
9. Cover up the well and remediate the disturbed area.