

FORM  
6Rev  
05/18

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401894843

Date Received:

01/07/2019

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10311

Contact Name: Julie Tannehill

Name of Operator: SRC ENERGY INC

Phone: (720) 616.4300

Address: 1675 BROADWAY SUITE 2600

Fax: (720) 616.4301

City: DENVER State: CO Zip: 80202

Email: jtannehill@srcenergy.com

For "Intent" 24 hour notice required,

Name: Peterson, Tom

Tel: (970) 370-1281

COGCC contact:

Email: tom.peterson@state.co.us

API Number 05-123-30456-00

Well Name: Keto

Well Number: 7-33

Location: QtrQtr: NESE Section: 7 Township: 4N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.324350

Longitude: -104.927950

GPS Data:

Date of Measurement: 05/06/2012

PDOP Reading: 2.3

GPS Instrument Operator's Name: C. Vanmatre

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 800

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7130	7152			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	742	520	742	0	VISU
1ST	7+7/8	4+1/2	11.6	7,293	480	7,293	3,240	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7055 with 28 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 8 sks cmt from 2400 ft. to 2250 ft. Plug Type: CASING Plug Tagged: ☐  
Set 263 sks cmt from 850 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged: ☒  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 68 sacks. Leave at least 100 ft. in casing 2400 CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Christi Ng

Title: Sr. Regulatory Analyst Date: 1/7/2019 Email: cng@srcenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Jacobson, Eric Date: 1/8/2019

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: 7/7/2019

<b>COA Type</b>	<b>Description</b>
	<p>If there has not been a reported Bradenhead test within 60 days of plugging this well, prior to starting plugging operations, a Bradenhead test shall be performed.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>3) If sampling is required contact COGCC engineering for an confirmation of plugging requirements prior to placing any plugs.</p> <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions.</p> <p>The Form 17 shall be submitted within 10 days of the test.</p>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Prior to placing the 850' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 692' or shallower and provide 10 sack plug at surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug.</p> <p>5) Properly abandon on-location flowlines as per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.

### **Attachment Check List**

<b>Att Doc Num</b>	<b>Name</b>
401894843	FORM 6 INTENT SUBMITTED
401894852	PROPOSED PLUGGING PROCEDURE
401894853	WELLBORE DIAGRAM

Total Attach: 3 Files

### **General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>
Engineer	<p>Deepest Water Well within 1 1/2 Miles – 300'</p> <p>SB5 Base of Fox Hills - N/A</p> <p>Changed casing cut depth on "Well Info" tab to 800' to match the WBD. Operator in agreement.</p>	01/08/2019
Permit	<ul style="list-style-type: none"> <li>•Verified SHL lat./long.</li> <li>•CODL perfed interval verified via Doc. 400294894</li> </ul>	01/07/2019
Well File Verification	Pass	01/07/2019

Total: 3 comment(s)