

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

01/17/2019

Submitted Date:

01/17/2019

Document Number:

688401097**FIELD INSPECTION FORM**Loc ID 423142 Inspector Name: Silver, Randy On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**OGCC Operator Number: 10672Name of Operator: TIMBER CREEK OPERATING LLCAddress: 1001 17TH STREET #1000City: DENVER State: CO Zip: 80202**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**10 Number of Comments4 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Beardslee, Tom		tom.beardslee@state.co.us	
Amato, Joseph	719-845-2110/719-859-2263	josephamato@tcenergy.us	All Inspections
Pesicka, Conor		conor.pesicka@state.co.us	
Santistevan, Vince	719-845-2102/719-680-9705	vincasantistevan@tcenergy.us	All Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
423123	WELL	PR	08/07/2012	GW	071-09864	APACHE CANYON 20-03	PR

General Comment:

LocationOverall Good: ☒

Signs/Marker:			
Type	OTHER		
Comment:	Location sign		
Corrective Action:		Date:	

Emergency Contact Number:

Comment:	Sign not posted or information inaccurate at well(s) or battery No one answers emergency contact number posted on well.		
Corrective Action:	Install sign to comply with Rule 210.b.	Date:	02/17/2019

Good Housekeeping:

Type	OTHER		
Comment:	3" VLV on outside of separator and packing on WH are leaking at time of inspection		
Corrective Action:	Securely fasten all valves, pipes, and fittings to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 605.d.	Date:	01/18/2019
Type	OTHER		
Comment:	Stained soil under 3" VLV by seperator and around WH		
Corrective Action:	Properly treat or dispose of oily waste in accordance with 907.e	Date:	02/18/2019
Type	TRASH		
Comment:	Unused poly pipe on location		
Corrective Action:	Comply with Rule 603.f .	Date:	01/31/2019

Overall Good: ☐

Spills:				
Type	Area	Volume		

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Fencing/:**

Type			
Comment:			
Corrective Action:		Date:	

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS	
PRODUCED WATER	1	OTHER	STEEL AST		,	
Comment:						
Corrective Action:						Date:

Paint

Condition		
-----------	--	--

Other (Content)	
Other (Capacity) 25BBL	
Other (Type)	

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Comment:				
Corrective Action:				Date:

Venting:

Yes/No	NO		
Comment:			
Corrective Action:			Date:

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected FacilitiesFacility ID: 423123 Type: WELL API Number: 071-09864 Status: PR Insp. Status: PR**Producing Well**Comment: PR

Corrective Action:

Date:

BradenHeadComment: Does not appear to be plumbed to surface

Corrective Action:

Date: _____

COGCC Comments

Comment	User	Date
3" VLV on seperator and packing leaking at time of inspection. Called emergency contact number at approximately 1:09 PM tried 3 more times no answers. I know this is a working number but no one answered and cannot leave voice mail. Tried Number again at approximately 1:59 PM Timber Creek rep answered in formed him of leak.	silverr	01/17/2019

Attached DocumentsYou can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
401909870	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4707413
688401098	loc pic	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4707402