

FORM  
6Rev  
05/18

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number:  401919152			
Date Received:			

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175	Contact Name: Valerie Danson
Name of Operator: PDC ENERGY INC	Phone: (970) 506-9272
Address: 1775 SHERMAN STREET - STE 3000	Fax:
City: DENVER State: CO Zip: 80203	Email: valerie.danson@pdce.com
For "Intent" 24 hour notice required, Name: Silver, Randy Tel: (720) 827-6688	
COGCC contact: Email: randy.silver@state.co.us	

API Number 05-123-26350-00	Well Number: 44-11
Well Name: GUTTERSEN	
Location: QtrQtr: SESE Section: 11 Township: 3N Range: 64W Meridian: 6	
County: WELD	Federal, Indian or State Lease Number:
Field Name: WATTENBERG	Field Number: 90750

☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.234360	Longitude: -104.511280
GPS Data:	
Date of Measurement: 06/10/2008	PDOP Reading: 1.2
GPS Instrument Operator's Name: HOLLY TRACY	
Reason for Abandonment: <input type="checkbox"/> Dry <input checked="" type="checkbox"/> Production Sub-economic <input type="checkbox"/> Mechanical Problems	
<input type="checkbox"/> Other	
Casing to be pulled: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Estimated Depth:
Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Details:	

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6616	6868			
Total: 1 zone(s)					

### Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	712	500	712	0	VISU
1ST	7+7/8	4+1/2	10.5	7,005	823	7,005	708	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6566 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 1800 ft. to 1300 ft. Plug Type: CASING Plug Tagged: ☐  
Set 75 sks cmt from 912 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 696 ft. with 180 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

#### Technical Detail/Comments:

Guttersen 44-11 (05-123-26350)/Plugging Procedure (Intent)

Producing Formation: Niobrara/Codell: 6616'-6868'

Upper Pierre Aquifer: 560'-1550'

TD: 7026' PBD: 6951'

Surface Casing: 8 5/8" 24# @ 712' w/ 500 sxs

Production Casing: 4 1/2" 10.5# @ 7005' w/ 823 sxs cmt (TOC @ 708' - CBL).

Tubing: 2 3/8" tubing set @ 6848' (8/29/2008).

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6566'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with tubing to 1800'. RU cementing company. Mix and pump 40 sxs 15.8#/gal CI G cement down tubing. (Pierre coverage from 1800'-1300'). TOOH with tubing.
5. TIH with perforation gun. Shoot 2 holes for annular squeeze at 696' @ 1 SPF or preferred.
6. TIH with tubing to 912'. RU cementing company. Mix and pump 75 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface. TOOH with tubing.
7. Close off casing returns. Hook up cement line to cement flange and pump 180 sxs 15.8#/gal CI G cement downhole and squeeze through perforations at 696' into annular space. Cement should circulate to surface.
8. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_

Print Name: Valerie Danson

Title: Reg Tech

Date: \_\_\_\_\_

Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type**

**Description**

--	--

**Attachment Check List**

**Att Doc Num**

**Name**

401919155	WELLBORE DIAGRAM
401919156	WELLBORE DIAGRAM
401919157	GYRO SURVEY

Total Attach: 3 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)