

FORM
6Rev
05/18State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401687920

Date Received:

07/12/2018

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: CHERYL LIGHT

Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP

Phone: (720) 929-6461

Address: P O BOX 173779

Fax: (720) 929-7461

City: DENVER State: CO Zip: 80217-

Email: cheryl.light@anadarko.com

For "Intent" 24 hour notice required,

Name: Duran, Alicia

Tel: (970) 370-1281

COGCC contact:

Email: alicia.duran@state.co.us

API Number 05-123-12544-00

Well Name: UPRR 21 PAN AM "K"

Well Number: 1

Location: QtrQtr: NESW Section: 35 Township: 4N Range: 66W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.266981

Longitude: -104.746464

GPS Data:

Date of Measurement: 10/02/2008

PDOP Reading: 2.3

GPS Instrument Operator's Name: Cody Mattson

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes☒ No

Estimated Depth:

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
SUSSEX	4478	4771			
CODELL	7276	7288	12/15/2008	B PLUG CEMENT TOP	6950
NIOBRARA	7011	7153	12/15/2008	B PLUG CEMENT TOP	6950

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	503	304	503	0	VISU
1ST	7+7/8	5+1/2	15.5	7,862	985	7,862	5,690	CALC
S.C. 1.1				4,770	800	4,770	4,200	CALC
S.C. 1.2				200	300	200	0	CALC

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 4400 with 2 sacks cmt on top. CIPB #2: Depth 80 with 10 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 6950 ft. to 6550 ft. Plug Type: CASING Plug Tagged: ☐
 Set 20 sks cmt from 3800 ft. to 3590 ft. Plug Type: CASING Plug Tagged: ☐
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 4170 ft. with 90 sacks. Leave at least 100 ft. in casing 3830 CICR Depth
 Perforate and squeeze at 1060 ft. with 220 sacks. Leave at least 100 ft. in casing 660 CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: CHERYL LIGHT
 Title: Staff Regulatory Analyst Date: 7/12/2018 Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: McCoy, Diane Date: 1/28/2019

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: 7/27/2019

COA Type	Description
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Properly abandon on-location flowlines per Rule 1105. File electronic Form 42 once abandonment complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line the operator must submit a Flowline Report, Form 44.</p> <p>3) Please submit gyro survey data with Form 6 Subsequent Report of Abandonment.</p> <p>4) Verify existing cement with a CBL prior to plugging and submit CBL with Form 6 Subsequent Report of Abandonment. If cement is not present on CBL as outlined on this Form contact COGCC engineer for an update to plugging orders.</p> <p>5) Tag CIBP at 6950' to confirm there. Pressure test CIBP prior to pumping cement on top.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p>

Attachment Check List

Att Doc Num	Name
401687920	FORM 6 INTENT SUBMITTED
401688071	PROPOSED PLUGGING PROCEDURE
401701253	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

User Group	Comment	Comment Date
Engineer	<p>Deepest water well within one mile =430'</p> <p>DWR's aquifer determination tool base of Laramie-Fox Hills = 330'</p> <p>Emailed operator to get an updated plugging procedure.</p> <p>Per email from operator added squeeze at 1060'. Added CIBP at 4400' for Sussex perms.</p>	01/09/2019
Permit	All formation interval depths incorrect and there is no J Sand reported in the well file. Plug set above NB-CD June 2009 that is not reported. Return to draft	07/12/2018
Well File Verification	Pass	07/03/2018

Total: 3 comment(s)