

NEW ELK 26-12 API # 05-071-08414 - TIMBER CREEK
OGCC OPERATOR NUMBER 10672 DATE: APRIL 16, 2019
CORRECTIVE ACTIONS COMPLETED REGARDING COGCC FIR DOCUMENT # 688401791



PHOTO 1: THE STAINS ON THE GROUND INSIDE OF THE CELLAR HAVE BEEN CLEANED UP.

NEW ELK 26-12 API # 05-071-08414 - TIMBER CREEK
OGCC OPERATOR NUMBER 10672 DATE: APRIL 16, 2019
CORRECTIVE ACTIONS COMPLETED REGARDING COGCC FIR DOCUMENT # 688401791



PHOTO 2: THE STAINS ON THE GROUND NEAR THE ENGINE SKID HAS BEEN CLEANED UP.

NEW ELK 26-12 API # 05-071-08414 - TIMBER CREEK
OGCC OPERATOR NUMBER 10672 DATE: APRIL 16, 2019
CORRECTIVE ACTIONS COMPLETED REGARDING COGCC FIR DOCUMENT # 688401791



PHOTO 3: THE STAINS ON THE GROUND AROUND THE ENGINE SKID HAS BEEN CLEANED UP.

NEW ELK 26-12 API # 05-071-08414 - TIMBER CREEK
OGCC OPERATOR NUMBER 10672 DATE: APRIL 16, 2019
CORRECTIVE ACTIONS COMPLETED REGARDING COGCC FIR DOCUMENT # 688401791



PHOTO 4: THE STAINS ON THE GROUND NEAR THE LIQUID RING COMPRESSOR HAVE BEEN CLEANED UP.

NEW ELK 26-12 API # 05-071-08414 - TIMBER CREEK
OGCC OPERATOR NUMBER 10672 DATE: APRIL 16, 2019
CORRECTIVE ACTIONS COMPLETED REGARDING COGCC FIR DOCUMENT # 688401791



PHOTO 5: THE GAUGE HATCH WAS CLOSED IN ACCORDANCE WITH RULE 605.A .

NEW ELK 26-12 API # 05-071-08414 - TIMBER CREEK
OGCC OPERATOR NUMBER 10672 DATE: APRIL 16, 2019
CORRECTIVE ACTIONS COMPLETED REGARDING COGCC FIR DOCUMENT # 688401791



PHOTO 6: THE "H" BRACE GUARD WAS RE-INSTALLED IN FRONT OF THE VALVES TO PROTECT THE VALVES. THE RED "T" HANDLE WAS PLACED BACK ON THE VALVE.

NEW ELK 26-12 API # 05-071-08414 - TIMBER CREEK
OGCC OPERATOR NUMBER 10672 DATE: APRIL 16, 2019
CORRECTIVE ACTIONS COMPLETED REGARDING COGCC FIR DOCUMENT # 688401791



PHOTO 7: THE DIRT BERM WAS DOMINATED AND THE EROSION RILL CORRECTED.

NEW ELK 26-12 API # 05-071-08414 - TIMBER CREEK
OGCC OPERATOR NUMBER 10672 DATE: APRIL 16, 2019
CORRECTIVE ACTIONS COMPLETED REGARDING COGCC FIR DOCUMENT # 688401791



PHOTO 8: THE DIRT BERM WAS DOMINATED AND THE EROSION RILL CORRECTED.