

FORM
6Rev
05/18State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402055113

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Silver, Randy

Tel: (720) 827-6688

COGCC contact:

Email: randy.silver@state.co.us

API Number 05-013-06361-00

Well Name: MEMCO MC

Well Number: 8-01

Location: QtrQtr: NENE Section: 8 Township: 1N Range: 69W Meridian: 6

County: BOULDER

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.071093

Longitude: -105.133049

GPS Data:

Date of Measurement: 07/29/2010

PDOP Reading: 2.6

GPS Instrument Operator's Name: Shantell Kling

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☒ Yes☐ No

Estimated Depth: 1700

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

| Formation | Perf. Top | Perf. Btm | Abandoned Date | Method of Isolation | Plug Depth |
|-----------------|-----------|-----------|----------------|---------------------|------------|
| NIOBRARA-CODELL | 7392 | 7788 | | | |

Total: 1 zone(s)

Casing History

| Casing Type | Size of Hole | Size of Casing | Weight Per Foot | Setting Depth | Sacks Cement | Cement Bot | Cement Top | Status |
|-------------|--------------|----------------|-----------------|---------------|--------------|------------|------------|--------|
| SURF | 12+1/4 | 8+5/8 | 24 | 690 | 395 | 690 | 0 | VISU |
| 1ST | 7+7/8 | 3+1/2 | 7.7 | 7,925 | 210 | 7,925 | 6,790 | CBL |

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7342 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 250 sks cmt from 1815 ft. to 1400 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set 450 sks cmt from 890 ft. to 0 ft. Plug Type: OPEN HOLE Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Memco Mc 8-01 (05-013-06361)/Plugging Procedure (Intent)
Producing Formation: Niobrara/Codell: 7392'-7788'
Upper Pierre Aquifer: 573'-1580'
TD: 7935' PBD: 7906'
Surface Casing: 8 5/8" 24# @ 690' w/ 395 sxs
Production Casing: 3 1/2" 7.7# @ 7925' w/ 210 sxs cmt (TOC @ 6790' - CBL).

Tubing: 1 1/2" tubing set @ 7395' (3/14/1994).

Proposed Procedure:

1. Run gyro survey.
2. MIRU pulling unit. Pull 2 3/8" tubing.
3. RU wireline company.
4. TIH with CIBP. Set BP at 7342'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with casing cutter. Cut 3 1/2" casing at 1700'. Pull cut casing.
6. TIH with tubing to 1815'. Mix and pump 250 sxs 15.8#/gal CI G cement w/ 2% CaCl down tubing (Pierre coverage from 1815'-1400').
7. Pick up tubing to 890'. Mix and pump 450 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface. TOOH with tubing.
8. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson
Title: Reg Tech Date: _____ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

| | |
|--|--|
| | |
|--|--|

Attachment Check List

Att Doc Num

Name

| | |
|-----------|------------------|
| 402055114 | WELLBORE DIAGRAM |
| 402055115 | WELLBORE DIAGRAM |

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

| | | |
|--|--|---------------------|
| | | Stamp Upon Approval |
|--|--|---------------------|

Total: 0 comment(s)