

Construction and Stormwater Inspection

July 29, 2019

Operator: CCRP OPERATING INC- 10665

Location ID: 456651

Inspection Document #: 697500395

Weld County, CO

SESE Section 18 T11N R64W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos

Location Name: Salt Ranch Fee /18 East

Location ID: 456651



Photo 1. Photo taken from the entrance of the location, facing South. Operator has installed a ditch which is directed to a retention area. Ditch area has been seeded and mulched. Inlet and outlets of culverts still need to be stabilized. Silt fence BMP was used as the initial stormwater BMP and will be removed.

Inspection Photos
Location Name: Salt Ranch Fee /18 East
Location ID: 456651



Photo 2. Photo taken from the entrance of the location, facing North. See comments under Photo 1.

Inspection Photos
Location Name: Salt Ranch Fee /18 East
Location ID: 456651



Photo 3. Photo taken from the southwestern location, facing East. Operator has installed straw wattles along portions of the ditch. Portions of the ditch may need to be

Inspection Photos

Location Name: Salt Ranch Fee /18 East

Location ID: 456651



Photo 4. Photo taken from the southwestern perimeter of the location, facing South. Operator failed to installed a retention area.

Inspection Photos
Location Name: Salt Ranch Fee /18 East
Location ID: 456651



Photo 5. Photo taken from the southwestern perimeter of the location, facing North.
See comments under Photo 1.

Inspection Photos
Location Name: Salt Ranch Fee /18 East
Location ID: 456651



Photo 6. Photo taken from the northern location, facing North. Photo illustrates the topsoil stockpile which has been seeded and mulched.

Inspection Photos
Location Name: Salt Ranch Fee /18 East
Location ID: 456651



Photo 7. Photo taken from the northeastern location, facing South. Photo illustrates other portions beyond the well locations has only been compacted. Compaction alone may not be sufficient to properly stabilize the well pad from wind and water erosion.

Inspection Photos
Location Name: Salt Ranch Fee /18 East
Location ID: 456651



Photo 8. Photo taken from a portion of the access road, facing Northwest. Access road was pre-existing. Operator has seeded along the roadside ditch. Mulch does not appear to have been installed evenly which may not protect the seeded soil.

Inspection Photos
Location Name: Salt Ranch Fee /18 East
Location ID: 456651



Photo 9. Photo taken from a portion of the access road, facing East. Photo illustrates inlet and outlets of culverts still need to be stabilized.



Photo 10. Photo taken from a portion of the access road, facing East. Photo illustrates inlet and outlets of culverts still need to be stabilized.

Inspection Photos
Location Name: Salt Ranch Fee /18 East
Location ID: 456651



Photo 11. Photo taken from a portion of the access road, facing North. Photo illustrates an area that was used to temporarily store topsoil from the access road. Operator will be responsible for complying with Rule 1004 standards for this area.