

FORM
6Rev
05/18

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402140593

Date Received:

08/12/2019

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Hunter Dunham

Name of Operator: NOBLE ENERGY INC

Phone: (303) 228-4308

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: hunter.dunham@nblenergy.com

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

API Number 05-123-17043-00

Well Name: UPRC

Well Number: 13-16J

Location: QtrQtr: SESE Section: 13 Township: 3N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.219950

Longitude: -104.605669

GPS Data:

Date of Measurement: 07/13/2006

PDOP Reading: 2.3

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ Other Offset to NBL HZ developmentCasing to be pulled: ☐ Yes ☒ No

Estimated Depth:

Fish in Hole: ☒ Yes ☐ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details: Two plungers left downhole at 7,146', beneath CIBP.

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
SUSSEX	4502	4521	06/19/2002	SQUEEZED	
CODELL	7080	7092	08/29/2018	B PLUG CEMENT TOP	6754
NIOBRARA	6804	6945	08/29/2018	B PLUG CEMENT TOP	6754

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	680	230	680	0	VISU
1ST	7+7/8	4+1/2	11.6	7,216	185	7,216	6,282	CBL
S.C. 1.1				4,950	478	4,950	3,998	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6754 with 20 sacks cmt on top. CIPB #2: Depth 4450 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 53 sks cmt from 730 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☒
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 76 sacks. Leave at least 100 ft. in casing 2400 CICR Depth
Perforate and squeeze at 730 ft. with 162 sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Taylor Heffner

Title: NBL Contractor Date: 8/12/2019 Email: theffner@phxresources.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Jacobson, Eric Date: 8/13/2019

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 2/12/2020

COA Type	Description
	<p>If there has not been a reported Bradenhead test within 60 days of plugging this well, prior to starting plugging operations, a Bradenhead test shall be performed.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required, and the COGCC engineering staff must be contacted.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>3) If sampling is required contact COGCC engineering for a confirmation of plugging requirements prior to placing any plugs.</p> <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions.</p> <p>The Form 17 shall be submitted within 10 days of the test.</p>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Prior to placing the 730' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 520' or shallower and provide 10 sack plug at surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug.</p> <p>5) Properly abandon on-location flowlines as per Rule 1105. File electronic Form 42 once abandonment is complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line, the operator must submit a Flowline Report, Form 44.</p> <p>6) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p> <p>7) After placing the shallowest hydrocarbon isolating plug (4450'), operator must wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.

Attachment Check List

Att Doc Num	Name
402140593	FORM 6 INTENT SUBMITTED
402141008	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group	Comment	Comment Date
Engineer	Well file verification not completed prior to approval of NOIA	08/13/2019
Engineer	Deepest Water Well within 1 Mile – 580' SB5 Base of Fox Hills - 570'	08/13/2019
Permit	Operator corrected zones tab and WBD. Pass.	08/12/2019
Permit	-Confirmed as-drilled well location. -Production reporting up-to-date. -Confirmed Nio-Codell interval and TA docnum: 401927457. -Confirmed Sussex productive interval docnum: 1340048. -Sussex was squeezed w/100 sx cmt on 6/19/2002, see docnum: 1340048. -Returned to draft for zones tab and WBD correction concerning Sussex squeeze.	08/12/2019

Total: 4 comment(s)