

FORM  
6Rev  
05/18

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402143373

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Hunter Dunham

Name of Operator: NOBLE ENERGY INC

Phone: (303) 228-4308

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: hunter.dunham@nblenergy.com

**For "Intent" 24 hour notice required,**

Name: Peterson, Tom

Tel: (970) 370-1281

**COGCC contact:**

Email: tom.peterson@state.co.us

API Number 05-123-14449-00

Well Name: BOHLENDER

Well Number: 33-5

Location: QtrQtr: SWNW Section: 33 Township: 4N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 68530

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.270640

Longitude: -104.675330

GPS Data:

Date of Measurement: 10/07/2010

PDOP Reading: 5.1

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other Offset to NBL HZ development

Casing to be pulled:

☐ Yes☒ No

Estimated Depth:

Fish in Hole:

☒ Yes☐ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details: There's a sinker bar fish at 7,228'.

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7178	7192			
NIOBRARA	6898	7095			

Total: 2 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	432	280	432	0	VISU
1ST	7+7/8	4+1/2	15.1	7,277	165	7,277	6,547	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6840 with 2 sacks cmt on top. CIPB #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 580 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 4000 ft. with 90 sacks. Leave at least 100 ft. in casing 3900 CICR Depth

Perforate and squeeze at 2500 ft. with 76 sacks. Leave at least 100 ft. in casing 2400 CICR Depth

Perforate and squeeze at 580 ft. with 130 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

--

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Taylor Heffner

Title: NBL Contractor Date: \_\_\_\_\_ Email: theffner@phxresources.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type** **Description**

--	--

### Attachment Check List

**Att Doc Num** **Name**

402143777	WELBORE DIAGRAM
-----------	-----------------

Total Attach: 1 Files

## General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Permit	<ul style="list-style-type: none"><li>•Verified SHL lat./long</li><li>•Verified perped intervals via Doc. 1081849</li><li>•Fish not on wellbore diagram; returned to draft</li></ul>	08/14/2019

Total: 1 comment(s)