

FORM
6

Rev
05/18

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402227891

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 8960 Contact Name: Russell Schucker
 Name of Operator: BONANZA CREEK ENERGY OPERATING COMPANY Phone: (303) 479-6774
 Address: 410 17TH STREET SUITE #1400 Fax: _____
 City: DENVER State: CO Zip: 80202 Email: regulatory@bonanzacr.com

For "Intent" 24 hour notice required, Name: Evins, Bret Tel: (970) 420-6699
COGCC contact: Email: bret.evins@state.co.us

API Number 05-123-30597-00 Well Number: 31-34
 Well Name: NORTH PLATTE
 Location: QtrQtr: NWNE Section: 34 Township: 5N Range: 63W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: WELDCOUNTY
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.361390 Longitude: -104.420110
 GPS Data:
 Date of Measurement: 06/13/2010 PDOP Reading: 2.4 GPS Instrument Operator's Name: larry robbins
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 750
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6492	6502			
NIOBRARA	6238	6388			
Total: 2 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	411	350	415	0	CALC
1ST	7+7/8	4+1/2	11.6	6,574	234	6,574	2,530	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6175 with 25 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 25 sks cmt from 2500 ft. to 2170 ft. Plug Type: CASING Plug Tagged:
 Set 550 sks cmt from 800 ft. to 0 ft. Plug Type: CASING Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)
 Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
 Set _____ sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Cut and Cap Date: _____
 of _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

- 1) MIRU ON LOCATION. ND WH, NU BOP, RU WORK FLOOR, CONTROL WELL
- 2) RU WIRELINE, TIH AND SET CIBP @ 6175'
- 3) SPOT 25 SX PLUG ON TOP OF PLUG
- 4) TEST CSG. IF CASING DOESN'T TEST SET PLUG ACROSS LEAK.
- 5) RIH WITH 2-3/8" TBG TO 2500', SET 25 SX CEMENT PLUG
- 6) MIRU WIRELINE. CUT AND PULL CASING FROM 750'
- 7) TIH WITH TO 800' 2 3/8THS TBG. MIRU CEMENTERS
- 8) MIRU CEMENTERS. ESTABLISH CIRCULATION, PUMP 550 SXS CEMENT TO SURFACE. TOO, LAY DOWN TBG
- 9) ND BOP. CUT OFF BELL NIPPLE & CASING TO 4' BELOW GROUND LEVEL. FILL TOP OF CASING WITH READY MIX
- 10) WELD ON PLATE. OPERATOR NAME, API NO., LOCATION
- 11) FILL SURFACE HOLE, MAKING SURE TO REPLACE TOP SOIL LAST
- 12) RIG DOWN AND MOVE OUT ALL EQUIPMENT

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Aubrey Noonan
 Title: Regulatory Analyst Date: _____ Email: regulatory@bonanzacr.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

<u>COA Type</u>	<u>Description</u>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
402233622	WELLBORE DIAGRAM
402233623	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)