

<div><div><div><div></div><div>noble</div><div>energy</div></div></div><div>Daily Operations</div></div>				
Well Name: OCOMA B29-12				
Daily Operations				
Well Name	API	Job Type	Start Date	Summary
OCOMA B29-12	05-123-13392	PLUG AND ABANDON	3/11/2019	MI, SFTY MTG, RU, TEST LINES AND BOPS, BRADENHEAD TEST 0 SRF 640 CSG 640 TBG, KILL WELL(PUMP 131 BBLS NO RETURNS), ND WH NU BOP, TEST SPOOL, SI
OCOMA B29-12	05-123-13392	PLUG AND ABANDON	3/12/2019	SFTY MTG, WHSIP 0 SRF 50 CSG 20 TBG, LD 224 JNTS TBG, RU WL, RIH W/ CIBP STACK OUT @ 6150', RIH W/ GAUGE RING/JUNK BASKET STACK OUT @6150', RD WL, PU SCRAPER/BIT PU TBG TALLY TIH 214 JNTS TO 6626', SI, SECURE LOCATION FOR IMPENDING WEATHER
OCOMA B29-12	05-123-13392	PLUG AND ABANDON	3/15/2019	SFTY MTG, CHECK FOR ICE, CLEAR SNOW, WHSIP 0 SRF 500 CSG 580 TBG, THAW VALVE ON FRAC TANK, BULLHEAD WELL, RACK TBG TO DERRICK, RU WL, SET CIBP @6608', DUMPBAIL 2 SX, RD WL, LOAD HOLE AND TEST 1000PSI 15 MIN, TIH WITH 67 STNDS, LD TBG, TIH W/ 45 STNDS, SI, CLEAR LINES
OCOMA B29-12	05-123-13392	PLUG AND ABANDON	3/16/2019	SFTY MTG, WHSIP 0 SRF 0 CSG 0 TBG, LD TBG, ND BOP/WH, RDMO
OCOMA B29-12	05-123-13392	PLUG AND ABANDON	3/18/2019	MIRU FLOW BACK. HELD SAFETY MEETING. IWP 0 PSI ON CSG & SUR. HOOK UP FLOW BACK TO WELL. TO CEMENT TANK. MIRU CASEDHOLE SOLUTIONS CRANE & WIRELINE TRUCK. HELD SAFETY MEETING. RIH W 3 1/8" 1' 6 SPF SQUEEZE GUN. SHOOT HOLES FROM 2500'-2499' W/KB. COME OUT WITH GUN 6 HOLES IN THE BARREL. RD CHS. MIRU HALLIBURTON. HELD SAFETY MEETING. PRESSURE TEST LINES TO 3000 PSI. PUMP 5 BBLS FRESH WATER, 10 BBLS MUD FLUSH, 5 BBLS SPACER, 200 SKS 41 BBLS 15.8 PPG G-NEAT CEMENT WITH 1% CC. GOT SMALL RETURNS AFTER 10 BBLS MUD FLUSH, THEN LOST CIRCULATION. PUMP @ 4 BPM, STARTING PSI @ 1140 PSI, DROPS DOWN TO 625 PSI HALF WAY THROUGH CEMENT JOB. START DISP @ 250 PSI FINISH WITH 630 SHUT IN AFTER 27.5 BBLS DISP. WAIT ONE HOUR. OPEN UP CSG & SUR. CSG WAS ATTEMPTING TO FLOW BACK. SHUT WELL IN FOR 30 MORE MIN. NO FLOW ON EITHER. RD HES. RU CHS. RIG UP LUBRICATOR. RIH. PRESSURE UP ON CSG TO 500 PSI DUE TO NO RETURNS SHOOT HOLES @ 540'-539' W/KB. COME OUT W/SPENT GUN 6 HOLES IN THE BARREL. RDMOL W/CHS. RU HES PUMP DOWN THE CSG @ 1 BPM @ 850 PSI. GET A TRICKLE BACK. PUMP 6 BBLS. SWITCH GO DOWN THE SURFACE @ 1.2 BPM @ 450 PSI, SLOWLY WORK UP TO 2 BPM. STILL @ 450 PSI. NO RETURNS. SWITCH AND GO BACK DOWN CSG WORKING IT UP TO 4 BPM @ 750 PSI AND DROPS OFF. NOT ABLE TO GET CIRC. RDMOL W/HES. SECURE WELL. SDFN. CREW TO YARD. NOT ABLE TO MOVE TO ANOTHER LOC. SDFN. 1' 6 SPF SQUEEZE GUN FROM 2500'-2499' W/KB. 200 SKS G-NEAT W/SILICA & 1%CC FROM 2500'-1940' W/KB. 1' 6 SPF SQUEEZE GUN FROM 540'-539'.
OCOMA B29-12	05-123-13392	PLUG AND ABANDON	3/27/2019	3/27/19 CREW AND EQUIP TO LOCATION. HELD SAFETY MTG. SPOTTED IN EQUIP AND RIG. RU BOHLER #7 AND PUMP AND TANK. IWP SURF 0#. RU CASED HOLE WIRELINE AND HELD SAFETY MTG W/ALL ON LOCATION. PICKED UP CSG CUTTER AND TIH. CUT CSG OFF AT 536' POOH AND RD WIRELINE. HELD SAFETY MTG W/ALL ON LOCATION. PICKED UP SPEAR AND UNLAND CSG. NU BOPS AND RIG FLOOR TRIED CIRCULATING WELL BORE. DID NOT CIRCULATE. LAID 18 JTS CSG DOWN ON TRAILER. CHG EQUIP OVER TO RUN 2 3/8 TBG. SECURE WELL SDFN
OCOMA B29-12	05-123-13392	PLUG AND ABANDON	3/28/2019	3/28/19 CREW TO LOCATION. HELD SAFETY MTG. IWP 0/0# SURF 0#. TIH W/ 18 JTS 2 3/8" TBG TO 554'. RU HALLIBURTON CEMENTERS. HELD SAFETY MTG. W/ALL ON LOCATION. PRESSURE TEST ALL SURF EQUIP. ESTABLISH CIRCULATION. MIXED 10 BBLS MUD FLUSH AND PUMP. FOLLOWED BY 5 BBL SPACER. FOLLOWED BY 210 SKS CMT. TILL CMT TO SURF. SHUT DOWN AND POOH W/ 2 3/8" TBG. ND BOPS AND TOPPED OF CMT W/1 BBL. CLEAN UP ALL EAUIP AND TANKS. RD CEMENTERS SECURE WELL RDMOL
Page 1/1				
Report Printed: 11/11/2019				