

Inspection Photos

3/2/2020

Operator: MARALEX RESOURCES INC - 53255

Location ID: 312599

Mesa County, CO

Aaron Trujillo
NW Reclamation Specialist
COGCC

Inspection Photos
Operator Name: MARALEX RESOURCES INC - 53255
Location ID: 312599



Photo 1: Photo taken from the access road on the east end of the Location, facing west. Photos 1-3 provide an overview of the Location from west northwest to north. Photos show erosion degradation remains evident; No stormwater BMPs have been installed in accordance with Rule 1002.f and corrective actions; No additional reclamation activities have been conducted.



Photo 2: See comments under photo 1.

Inspection Photos

Operator Name: MARALEX RESOURCES INC - 53255

Location ID: 312599



Photo 3: See comments under photo 1.



Photo 4: Photo taken from the access road, facing west. Photo shows sediment discharge from the Location onto the road. 6 foot measuring stick for reference.

Inspection Photos
Operator Name: MARALEX RESOURCES INC - 53255
Location ID: 312599



Photo 5: Photo taken from the access road, facing north. Photo shows sediment discharge from the Location onto the road. 6 foot measuring stick for reference.



Photo 6: Photo taken from the access road, facing south. Photo shows sediment discharge from the Location onto the road. 6 foot measuring stick for reference.

Inspection Photos

Operator Name: MARALEX RESOURCES INC - 53255

Location ID: 312599



Photo 7: Photo taken from the access road, facing north. Photo shows stormwater runoff has caused degradation to the access road, and transported sediment off Location.



Photo 8: Photo taken from the access road, facing east. Photo shows erosion degradation on the eastern areas of the Location.

Inspection Photos
Operator Name: MARALEX RESOURCES INC - 53255
Location ID: 312599



Photo 9: Photo taken from the access road, facing south. Photo shows stormwater erosion at access road has not been repaired/stabilized. Stormwater has continued to incise into the access road exposing the culvert. 6 foot measuring stick for reference.



Photo 10: Continued from photo 9. Photo shows areas where Stormwater has continued to incise into the access road exposing the culvert (arrow).

Inspection Photos
Operator Name: MARALEX RESOURCES INC - 53255
Location ID: 312599



Photo 11: Photo taken from the Location, facing west. Photo shows gully erosion has not been repaired and stabilized, and stormwater BMPs have not been installed/maintained. 6 foot measuring stick for reference.



Photo 12: Photo taken from the Location, photo shows a rock-check documented in the previous inspection. Photo shows BMP has not been repaired or maintained in proper functioning condition, and installed in accordance with good engineering practices.

Inspection Photos

Operator Name: MARALEX RESOURCES INC - 53255

Location ID: 312599



Photo 13: Photo taken from the Location, facing west. Photo shows slopes remain unstabilized; No additional reclamation or stormwater activities observed per corrective actions.



Photo 14: Photo taken from the east end of the location, facing east. Photo shows sediment trap has not been maintained and has filled with sediment due to sediment laden stormwater discharge.