

**FORM
INSP**

Rev
X/15

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

03/04/2020

Submitted Date:

03/04/2020

Document Number:

689901861

FIELD INSPECTION FORM

Loc ID 309135 Inspector Name: COSTA, RYAN On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 10672
Name of Operator: TIMBER CREEK OPERATING LLC
Address: 6295 GREENWOOD PLAZA BLVD #100
City: GREENWOOD State: CO Zip: 8111-

Findings:

- 4 Number of Comments
- 1 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
FITZGERALD EDIE		ediefitzgerald@tcenergy.us	
THOMASON KIM		kimthomason@tcenergy.us	
BAKER DAVID		dbaker@auroramp.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
288592	WELL	PR	12/27/2006	GW	071-09132	APACHE CANYON 5-11	RI

General Comment:

This is a stormwater and location inspection.
See attached photos and additional details within this report.

Location

Lease Road:

Type

comment: There is vehicle rutting along the main lease road. The road needs to be maintained.

Corrective ActionL

Date:

Overall Good:

Signs/Marker:

Type

Comment: Good

Corrective Action:

Date:

Emergency Contact Number:

Comment:

Corrective Action:

Date: _____

Good Housekeeping:

Type

Comment:

Corrective Action:

Date:

Overall Good:

Spills:

Type

Area

Volume

In Containment: No

Comment:

Multiple Spills and Releases?

Venting:

Yes/No

Comment:

Corrective Action:

Date:

Flaring:

Type

Comment:

Corrective Action:

Date:

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: There is vehicle rutting along the main lease road. The road needs to be graded and maintained. The areas of rutting on the road may need gravel and compaction to prevent rutting of the road. The road further up the canyon may also need maintenance.

Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)C

Date: 03/20/2020

Pits: NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
402331936	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5085230
689901862	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5085223