

Inspection Photos

5/04/2020

Operator: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 454383

Garfield County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC - 96850
Location ID: 454383



Photo 1: Photo taken from the wells, facing south. Photo shows the active/producing wells on the Location; Records show all wells appear to be producing by 11/26/2019.



Photo 2: Photo taken from the Location facing north. Photo shows separators on Location.

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC - 96850
Location ID: 454383



Photo 3: Photo taken from the northwest end of the Location, facing north. Photos 3-5 provide an overview of the Location from north, east to south. Photo shows interim reclamation activities are in process.

Photo 4: See comments under photo 3.

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC - 96850
Location ID: 454383



Photo 5: See comments under photo 3.



Photo 6: Photo taken from the west end of the Location, facing west. Photo shows erosion degradation on the cut slopes; Insufficient BMPs, or BMPs missing, to stabilize the slopes, manage runoff and prevent degradation to the Location.

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC - 96850
Location ID: 454383



Photo 7: See comments under photo 6.



Photo 8: See comments under photo 6.

Inspection Photos

Operator Name: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 454383



Photo 9: Photo taken from the southwest end of the Location. Photo shows velocity checks within stormwater diversion ditch.



Photo 10: Photo taken from the southeast end of the Location/Location entrance, facing east from the access road. Photo shows erosion degradation and sediment deposition; Insufficient BMPs, or BMPs missing, to stabilize the slopes, manage runoff and prevent degradation to the Location.

Inspection Photos

Operator Name: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 454383



Photo 11: Photo taken from the access road, facing east. Photo shows erosion bales have not been installed in accordance with good engineering practices (entrenched) and/or maintained in proper functioning condition. Sediment discharge into an intermittent stream evident.



Photo 12: See comments under photo 11.

Inspection Photos
Operator Name: TEP ROCKY MOUNTAIN LLC - 96850
Location ID: 454383



Photo 13: See comments under photo 11.



Photo 14: Photo of erosion bales on the eastern perimeter of the Location. Erosion bales are temporary sediment control structures that are required to be entrenched. Photo shows BMP has not been entrenched; BMP has not been installed in accordance with good engineering practices.

Inspection Photos

Operator Name: TEP ROCKY MOUNTAIN LLC - 96850

Location ID: 454383



Photo 15: Photo taken from the southeast end of the Location/Location entrance, facing south. Photo shows sediment has filled areas between the slope and the erosion bales. BMP is no longer in proper functioning condition.



Photo 16: Continued from photo 15.