

FORM
6Rev
02/20State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Replug By Other Operator

Document Number:

402407351

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER

State: CO

Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Santistevan, Brittani

Tel: (720) 471-1110

COGCC contact:

Email: brittani.santistevan@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-07326-00

Well Name: LESSER

Well Number: 1

Location: QtrQtr: NENE

Section: 21

Township: 5N

Range: 66W

Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.390390

Longitude: -104.778620

GPS Data: GPS Quality Value: 1.6 Type of GPS Quality Value: PDOP

Date of Measurement: 05/05/2020

GPS Instrument Operator's Name: Scott Sherard

Reason for Abandonment: ☐ Dry☐ Production Sub-economic☐ Mechanical Problems☒ Other Re-enter to Re-plug for PDC's Ridge developmentCasing to be pulled: ☐ Yes☒ No

Estimated Depth:

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth

Total: 0 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	165	160	165	0	VISU

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set	178	sks cmt from	6950	ft. to	6450	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input checked="" type="checkbox"/>
Set	178	sks cmt from	4120	ft. to	3620	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input checked="" type="checkbox"/>
Set	178	sks cmt from	1720	ft. to	1220	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input checked="" type="checkbox"/>
Set	_____	sks cmt from	_____	ft. to	_____	ft.	Plug Type:	_____	Plug Tagged:	<input type="checkbox"/>
Set	_____	sks cmt from	_____	ft. to	_____	ft.	Plug Type:	_____	Plug Tagged:	<input type="checkbox"/>

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 195 sacks half in. half out surface casing from 570 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Cut and Cap Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Lesser 1 (05-123-07326)/Re-Enter to Re-Plug Procedure (Intent)

Original Plug Date: 6/8/1971

Producing Formation: N/A (DA well)

Upper Pierre Aquifer: 470'-1470'

TD: 7846'

Surface Casing: 8 5/8" 24# @ 165' w/ 160 sxs cmt

Open Hole: 7 7/8" @ 7846'

Existing Plugs: 390'-116' (95 sx cmt), 20' to Surface (10 sx cmt)

Proposed Procedure:

1. Dig out to find wellhead and check pressure.
2. Cut cap off, extend surface pipe to achieve ground level.
3. MIRU WO unit, ND wellhead, NU BOP, tally all pipe to be ran in well.
4. Mill cement, cement btm is approximately 390' according to well history data.
5. Wash run down to top of Niobrara @ 7000' or depth that well allows.
6. PU tubing to 6950'. RU cementing company. Mix and pump 178 sxs 15.8#/gal CI G cement down tubing (Nio coverage 6950'-6450'). PU tubing above plug and SI well. (Top of Niobrara @ 7000')
 - a. Wait 4 hours and tag plug
7. PU tubing to 4120'. RU cementing company. Mix and pump 178 sxs 15.8#/gal CI G cement down tubing (Sussex coverage 4120'-3620'). PU tubing above plug and SI well. (Top of Sussex @ 4170')
 - a. Wait 4 hours and tag plug
8. PU tubing to 1720'. RU cementing company. Mix and pump 178 sxs 15.8#/gal CI G cement down tubing (Pierre Aquifer coverage 1720'-1220'). PU tubing above plug and SI well.
 - a. Wait 4 hours and tag plug
9. PU tubing to 570'. RU cementing company. Mix and pump 195 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface. LD tubing.
 - a. Wait 4 hours and tag plug
10. RDMO WO unit. Remove extension of surface pipe. Top off if necessary.
11. Weld on cap with ID plate, inscribed with well location, and identity. Backfill, clean location, Re-Entry complete.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson
Title: Reg Tech Date: _____ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

COA Type **Description**

--	--

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
402407355	WELLBORE DIAGRAM
402407356	WELLBORE DIAGRAM
402407357	LOCATION PHOTO
402407358	SURFACE OWNER CONSENT

Total Attach: 4 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)