

Document Number:  
 402435031

Date Received:

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Valerie Danson  
 Name of Operator: PDC ENERGY INC Phone: (970) 506-9272  
 Address: 1775 SHERMAN STREET - STE 3000 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80203 Email: valerie.danson@pdce.com

**For "Intent" 24 hour notice required,** Name: Evins, Bret Tel: (970) 420-6699  
**COGCC contact:** Email: bret.evins@state.co.us

Type of Well Abandonment Report:  Notice of Intent to Abandon  Subsequent Report of Abandonment

API Number 05-123-23054-00  
 Well Name: CORNISH Well Number: 21-3  
 Location: QtrQtr: NENW Section: 3 Township: 6N Range: 63W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_  
 Field Name: WATTENBERG Field Number: 90750

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.521690 Longitude: -104.424890  
 GPS Data: GPS Quality Value: 2.5 Type of GPS Quality Value: \_\_\_\_\_ Date of Measurement: 11/06/2007  
 GPS Instrument Operator's Name: Holly L. Tracy  
 Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: 1680  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6756	6762			

Total: 1 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	400	220	400	0	VISU
1ST	7+7/8	4+1/2	10.5	6,900	460	6,900	2,170	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6706 with 2 sacks cmt on top. CIBP #2: Depth 6447 with 2 sacks cmt on top.  
 CIBP #3: Depth 2920 with 2 sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 80 sks cmt from 1730 ft. to 1480 ft. Plug Type: STUB PLUG Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)  
 Set 198 sacks half in. half out surface casing from 600 ft. to 0 ft. Plug Tagged:   
 Set \_\_\_\_\_ sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Cut and Cap Date: \_\_\_\_\_  
 of \_\_\_\_\_  
 \*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
 Type of Cement and Additives Used: \_\_\_\_\_  
 Flowline/Pipeline has been abandoned per Rule 1105  Yes  No

Technical Detail/Comments:

Cornish 21-3 (05-123-23054)/Plugging Procedure (Intent)  
 Producing Formation: Codell: 6756'-6762'  
 Upper Pierre Aquifer: 480'-1580'  
 TD: 6951' PBTD: 6874' (12/20/2013)  
 Surface Casing: 8 5/8" 24# @ 400' w/ 220 sx cmt  
 Production Casing: 4 1/2" 10.5# @ 6900' w/ 460 sx cmt (TOC @ 2170' - CBL)  
 Tubing: 2 3/8" tubing set @ 6741' (5/15/2014)  
 Proposed Procedure:  
 1. MIRU pulling unit. Pull 2 3/8" tubing.  
 2. RU wireline company.  
 3. TIH with CIBP. Set BP at 6706'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Codell perms @ 6756')  
 4. TIH with CIBP. Set BP at 6447'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara @ 6497')  
 5. TIH with CIBP. Set BP at 2920'. Top with 2 sxs 15.8#/gal CI G cement.  
 6. TIH with casing cutter. Cut 4 1/2" casing @ 1680'. Pull cut casing.  
 7. TIH with tubing to 1730'. RU cementing company. Mix and pump 80 sxs 15.8#/gal CI G cement down tubing. (Stub/Pierre plug from 1680'-1480')  
 8. Pick up tubing to 600'. Mix and pump 198 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.  
 9. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson  
 Title: Reg Tech Date: \_\_\_\_\_ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

<u>COA Type</u>	<u>Description</u>

### **Attachment Check List**

<u>Att Doc Num</u>	<u>Name</u>
402435053	WELLBORE DIAGRAM
402435056	WELLBORE DIAGRAM

Total Attach: 2 Files

### **General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)