

**FORM
INSP**

Rev
X/15

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

07/08/2020

Submitted Date:

07/08/2020

Document Number:

699601370

FIELD INSPECTION FORM

Loc ID 312264 Inspector Name: SCHURE, KYM On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 95620
Name of Operator: WESTERN OPERATING COMPANY
Address: 1165 DELAWARE STREET #200
City: DENVER State: CO Zip: 80204

Findings:

- 3 Number of Comments
- 1 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
James, Steven	(303) 893-2438	steve@westernoperating.com	
Quint, Craig		craig.quint@state.co.us	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
220269	WELL	IJ	06/29/2015	ERIW	075-08391	EMERALD 2-35	SI

General Comment:

WO - Day (2) - Rig On-site - Assessing source of pressure loss per Doc#699601224 Failed UIC/MIT.

Note to Operator: Contact COGCC Field Group (Schure) after determination of work-over results and related decisions for repair or P&A. Process of repair/restore or P&A remains as stated in Doc#699601224 CA date 12/15/2020. Well must remain SI until COGCC approved resolution is attained.

Inspected Facilities

Facility ID: 220269 Type: WELL API Number: 075-08391 Status: IJ Insp. Status: SI

Workover

Comment: WO - Rig-On-Site - Assessing source of pressure loss per Doc#699601224. Safety meeting - Tripped/Inspected tubing, reset packer, loaded hole, waited for stability, pressured up for pre-MIT. Well did not hold pressure. Operator is currently determining options per Doc#699601224, CA date 12-15-2020 , repair and provide witnessed MIT or P&A well prior to 12-15-2020. Well must remain SI until approved by COGCC.

Corrective Action: **Repair and pass MIT or P&A.**

Date: 12/15/2020

COGCC Comments

Comment	User	Date
WO - Assessing source of pressure loss cited in Doc#699601224. Initial repairs were performed, tubing and re-set packer, preliminary test performed, well did not hold pressure. Contact COGCC N.E. Field Office with determination of options for well per Doc#699601224. Well must remain SI.	schureky	07/08/2020