

FORM  
6Rev  
11/20

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402532818

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

**For "Intent" 24 hour notice required,**

Name: Serna, Abe

Tel: (720) 661-7317

**COGCC contact:**

Email: abe.serna@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-17463-00

Well Name: MONFORT

Well Number: 4

Location: QtrQtr: SWSW Section: 30 Township: 6N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 55752

Field Name: GREELEY

Field Number: 32760

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.453611

Longitude: -104.713889

GPS Data: GPS Quality Value: 1.8 Type of GPS Quality Value: Date of Measurement: 01/22/2010

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 2500Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7146	7156			

Total: 1 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	313	300	313	0	VISU
1ST	7+7/8	4+1/2	J55	11.6	0	7254	165	7254	6430	CBL

Subsurface hazards include, but are not limited to, the following: overpressured zones, underpressured zones, major geologic faults, salt sections, H<sub>2</sub>S at concentrations greater than or equal to 100 ppm.

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7096 with 2 sacks cmt on top. CIBP #2: Depth 6776 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2550 ft. to 2300 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set 100 sks cmt from 1550 ft. to 1350 ft. Plug Type: OPEN HOLE Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)

Set 205 sacks half in. half out surface casing from 515 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

#### Technical Detail/Comments:

Monfort 4 (05-123-17463)/Plugging Procedure (Intent)  
Producing Formation: Codell: 7146'-7156'

Upper Pierre Aquifer: 400'-1450'

TD: 7301' PBTD: 7175' (9/15/2014)

Surface Casing: 8 5/8" 24# @ 313' w/ 300 sxs cmt

Production Casing: 4 1/2" 11.6# @ 7254' w/ 165 sxs cmt (TOC @ 6430' - CBL)

Tubing: 2 3/8" tubing set @ 7138' (10/23/2014)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 7096'. Top with 2 sx 15.8#/gal CI G cement. (Top of Codell perms @ 7146')
4. TIH with CIBP. Set BP at 6776'. Top with 2 sx 15.8#/gal CI G cement. (Top of Niobrara @ 6826')
5. TIH with casing cutter. Cut 4 1/2" casing @ 2500'. Pull cut casing.
6. TIH with tubing to 2550'. RU cementing company. Mix and pump 100 sx 15.8#/gal CI G cement down tubing. (Stub plug from 2550'-2300')
7. TIH with tubing to 1550'. Mix and pump 100 sx 15.8#/gal CI G cement down tubing. (Pierre coverage from 1550'-1350')
8. Pick up tubing to 515'. Mix and pump 205 sx 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
9. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_

Print Name: Valerie Danson

Title: Reg Tech Date: Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Date:

CONDITIONS OF APPROVAL, IF ANY: Expiration Date:

COA Type	Description

### Attachment Check List

Att Doc Num	Name
402532819	WELLBORE DIAGRAM
402532820	WELLBORE DIAGRAM
402532821	GYRO SURVEY

Total Attach: 3 Files

### General Comments

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)