

FORM
6Rev
11/20

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402554940

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Evins, Bret

Tel: (970) 420-6699

COGCC contact:

Email: bret.evins@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-20155-00

Well Name: DEWEY

Well Number: 22-28

Location: QtrQtr: SENW Section: 28 Township: 6N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.459220

Longitude: -104.557470

GPS Data: GPS Quality Value: 1.8 Type of GPS Quality Value: Date of Measurement: 06/24/2010

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 1580Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6911	6916			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	401	280	401	0	VISU
1ST	7+7/8	4+1/2	J55	10.5	0	7146	400	7146	2388	CBL

Subsurface hazards include, but are not limited to, the following: overpressured zones, underpressured zones, major geologic faults, salt sections, H₂S at concentrations greater than or equal to 100 ppm.

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6861 with 2 sacks cmt on top. CIBP #2: Depth 6564 with 2 sacks cmt on top.
CIBP #3: Depth 3000 with 2 sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 1630 ft. to 1380 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 220 sacks half in. half out surface casing from 601 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Dewey 22-28 (05-123-20155) Plugging Procedure (Intent)
Producing Formation: Codell: 6911'-6916'

Upper Pierre Aquifer: 420'-1480'

TD: 7168' PBD: 7124' (3/16/2001)

Surface Casing: 8 5/8" 24# @ 401' w/ 280 sxs

Production Casing: 4 1/2" 10.5# @ 7146' w/ 400 sxs cmt (TOC @ 2388' - CBL)

Tubing: 2 3/8" tubing set @ 6904' (1/15/2001)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6861'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Codell perms @ 6911')
4. TIH with CIBP. Set BP at 6564'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara @ 6614')
5. TIH with CIBP. Set BP at 3000'. Top with 2 sxs 15.8#/gal CI G cement.
6. TIH with casing cutter. Cut 4 1/2" casing at 1580'. Pull cut casing.
7. TIH with tubing to 1630'. RU cementing company. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre Coverage @ 1630'-1380')
8. Pick up with tubing to 601'. Mix and pump 220 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
9. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Valerie Danson

Title: Reg Tech

Date: _____

Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

<u>COA Type</u>	<u>Description</u>
-----------------	--------------------

--	--

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
--------------------	-------------

402554944	WELLBORE DIAGRAM
402554945	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>
-------------------	----------------

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)