



DE	ET	OE	ES
Document Number: 402561744			
Date Received:			

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen  
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800  
 Address: 1775 SHERMAN STREET - STE 3000 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80203 Email: JEnifer.Hakkarinen@pdce.com

**For "Intent" 24 hour notice required,** Name: Evins, Bret Tel: (970) 420-6699  
**COGCC contact:** Email: bret.evins@state.co.us

Type of Well Abandonment Report:  Notice of Intent to Abandon  Subsequent Report of Abandonment

API Number 05-123-14166-00  
 Well Name: KREPS Well Number: 11-7  
 Location: QtrQtr: NWNW Section: 7 Township: 6N Range: 64W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: 63255  
 Field Name: WATTENBERG Field Number: 90750

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.505970 Longitude: -104.599780  
 GPS Data: GPS Quality Value: 5.2 Type of GPS Quality Value: \_\_\_\_\_ Date of Measurement: 03/09/2007

Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_

Casing to be pulled:  Yes  No Estimated Depth: \_\_\_\_\_  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6780	7064			

Total: 1 zone(s)

**Casing History**

--

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	329	175	329	0	VISU
1ST	7+7/8	4+1/2	J-55	11.6	0	7223	220	7223	6285	CBL
S.C. 1.1						5201	200	5201	0	CALC

Subsurface hazards include, but are not limited to, the following: overpressured zones, underpressured zones, major geologic faults, salt sections, H2S at concentrations greater than or equal to 100 ppm.

### Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6730 with 2 sacks cmt on top. CIBP #2: Depth 3610 with 2 sacks cmt on top.

CIBP #3: Depth 2500 with 2 sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 124 sacks half in. half out surface casing from 1630 ft. to 0 ft. Plug Tagged:

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing

Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_ Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105  Yes  No

Technical Detail/Comments:

Kreps 11-7 (05-123-14166)/Plugging Procedure (Intent)  
 Producing Formation: Nio/Codell: 6780'-7064'  
 Upper Pierre Aquifer: 460'-1530'  
 TD: 7230' PBD: 7125' (3/20/15)  
 Surface Casing: 8 5/8" 24# @ 329' w/ 175 sxs cmt  
 Production Casing: 4 1/2" 11.6# @ 7223' w/ 220 sxs cmt (TOC @ 6285 - CBL)  
 Annfill: 5201'-Surface (TOC @ Surface, est)

Tubing: 2 3/8" tubing set @ 7037' (12/19/2011)

Proposed Procedure:

1. MIRU. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6730'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Nio/Codell perms @ 6780')
4. RIH with CBL to 5400', log out of hole to confirm TOC, adjust subsequent plugs as necessary.
5. TIH with CIBP. Set BP at 3610'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Parkman @ 3660')
6. TIH with CIBP. Set BP at 2500'. Top with 2 sxs 15.8#/gal CI G cement. (Courtesy Plug)
7. TIH with tubing to 1630'. Mix and pump 124 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
8. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen  
 Title: Reg Tech Date: \_\_\_\_\_ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_ Expiration Date: \_\_\_\_\_

<u>COA Type</u>	<u>Description</u>

**Attachment Check List**

<u>Att Doc Num</u>	<u>Name</u>
402561750	WELLBORE DIAGRAM
402561751	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)