

FORM  
6Rev  
11/20

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402567139

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

**For "Intent" 24 hour notice required,**

Name: Serna, Abe

Tel: (720) 661-7317

**COGCC contact:**

Email: abe.serna@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-20671-00

Well Name: ANDERSON

Well Number: 12-13

Location: QtrQtr: SWNW Section: 13 Township: 6N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.487860

Longitude: -104.617890

GPS Data: GPS Quality Value: 1.2 Type of GPS Quality Value: Date of Measurement: 06/03/2010

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 2500Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7012	7022			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	421	295	421	0	VISU
1ST	7+7/8	4+1/2	J55	10.5	0	7151	540	7151	3030	CBL

Subsurface hazards include, but are not limited to, the following: overpressured zones, underpressured zones, major geologic faults, salt sections, H<sub>2</sub>S at concentrations greater than or equal to 100 ppm.

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6962 with 2 sacks cmt on top. CIBP #2: Depth 6607 with 2 sacks cmt on top.  
CIBP #3: Depth 3542 with 2 sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2550 ft. to 2300 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set 100 sks cmt from 1540 ft. to 1340 ft. Plug Type: OPEN HOLE Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 225 sacks half in. half out surface casing from 621 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing

Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_ Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_

\*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Anderson 12-13 (05-123-20671)/Plugging Procedure (Intent)

Producing Formation: Codell: 7012'-7022'

Upper Pierre Aquifer: 460'-1440'

TD: 7184' PBTD: 7120' (10/13/2014)

Surface Casing: 8 5/8" 24# @ 421' w/ 295 sxs cmt

Production Casing: 4 1/2" 10.5 @ 7151' w/ 540 sxs cmt (TOC @ 3030' - CBL)

Tubing: 2 3/8" tubing set @ 7000' (10/13/2014)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6962'. Top with 2 sxs 15.8#/gal CI G cement. (Codell Perfs @ 7012')
4. TIH with CIBP. Set BP at 6607'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara @ 6657')
5. TIH with CIBP. Set BP at 3542'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Parkman @ 3592')
6. TIH with casing cutter. Cut 4 1/2" casing @ 2500'. Pull cut casing.
7. TIH with tubing to 2550'. RU cementing company. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Stub plug from 2550'-2300')
8. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations
9. TIH with tubing to 1540'. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre coverage from 1540'-1340')
10. Pick up tubing to 621'. Mix and pump 225 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
11. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_

Print Name: Valerie Danson

Title: Reg Tech Date: Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Date:

CONDITIONS OF APPROVAL, IF ANY: Expiration Date:

COA Type	Description

Attachment Check List

Att Doc Num	Name
402567140	WELLBORE DIAGRAM
402567141	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)