

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

Document Number:
 402568675
 Date Received:

OGCC Operator Number: 10254 Contact Name: Shannon Chollett
 Name of Operator: RED MESA HOLDINGS/O&G LLC Phone: (303) 894-2100 x5102
 Address: 5619 DTC PARKWAY - STE 800 Fax: _____
 City: GREENWOOD State: CO Zip: 80111 Email: shannon.chollett@state.co.us

For "Intent" 24 hour notice required, Name: Labowskie, Steve Tel: (970) 946-5073
COGCC contact: Email: steve.labowskie@state.co.us

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-067-06111-00
 Well Name: FERGUSON NO.1 (OWP) Well Number: F35-1
 Location: QtrQtr: SWNW Section: 35 Township: 33N Range: 12W Meridian: N
 County: LA PLATA Federal, Indian or State Lease Number: _____
 Field Name: RED MESA Field Number: 72890

Only Complete the Following Background Information for Intent to Abandon

Latitude: 37.063200 Longitude: -108.125950
 GPS Data: GPS Quality Value: 1.9 Type of GPS Quality Value: PDOP Date of Measurement: 10/09/2008

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other OWP Plugging Project

Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
DAKOTA	3608	3638			
Total: 1 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12	8+5/8	NA	24	0	1101		1101	0	VISU
1ST	8	4+1/2	NA	10.5	0	3719	90	3719	3429	CALC

Subsurface hazards include, but are not limited to, the following: overpressured zones, underpressured zones, major geologic faults, salt sections, H2S at concentrations greater than or equal to 100 ppm.

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 3558 with 30 sacks cmt on top. CIBP #2: Depth 759 with 35 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 107 sks cmt from 809 ft. to 400 ft. Plug Type: CASING Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 2603 ft. with 30 sacks. Leave at least 100 ft. in casing 2533 CICR Depth
 Perforate and squeeze at 1484 ft. with 30 sacks. Leave at least 100 ft. in casing 1434 CICR Depth
 Perforate and squeeze at 1151 ft. with 40 sacks. Leave at least 100 ft. in casing 1101 CICR Depth
(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
 Set 16 sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____
 Surface Plug Setting Date: _____ Cut and Cap Date: _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

CICR to be set @ 759' with 107 sx squeezed and 35 sx on top, as represented per wellbore diagram, is represented as a CIBP with a casing plug from 809' to 400' in the Plugging Procedure tab as there wasn't enough perforate and squeeze options to accomodate this procedure.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Shannon Chollett
 Title: OWP Engineer Date: _____ Email: shannon.chollett@state.co.us

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

COA Type	Description

Attachment List

Att Doc Num

Name

402568704

WELLBORE DIAGRAM

Total Attach: 1 Files

General Comments

User Group

Comment

Comment Date

Stamp Upon
Approval

Total: 0 comment(s)