

FORM

6

Rev
11/20

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Replug By Other Operator

Document Number:

402568713

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10254

Contact Name: Shannon Chollett

Name of Operator: RED MESA HOLDINGS/O&G LLC

Phone: (303) 894-2100 x5102

Address: 5619 DTC PARKWAY - STE 800

Fax:

City: GREENWOOD State: CO Zip: 80111

Email: shannon.chollett@state.co.us

For "Intent" 24 hour notice required,

Name: Labowskie, Steve

Tel: (970) 946-5073

COGCC contact:

Email: steve.labowskie@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-067-06078-00

Well Name: KROEGER-FERGUSON NO.3

Well Number: K-3

Location: QtrQtr: SESW Section: 34 Township: 33N Range: 12W Meridian: N

County: LA PLATA

Federal, Indian or State Lease Number:

Field Name: RED MESA

Field Number: 72890

Only Complete the Following Background Information for Intent to Abandon

Latitude: 37.057310

Longitude: -108.141060

GPS Data: GPS Quality Value: 2.2 Type of GPS Quality Value: PDOP Date of Measurement: 10/09/2008

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☒ Other OWP Plugging ProjectCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
DAKOTA	3512	3650			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
CONDUCTOR	13+3/4	12+3/4	NA	NA	0	20	2	20	0	VISU
SURF	10+5/8	8+5/8	NA	24	0	1446	120	1446	0	VISU
1ST	7+7/8	5+1/2	NA	15.5	0	3808	73	3808	3166	CALC

Subsurface hazards include, but are not limited to, the following: overpressured zones, underpressured zones, major geologic faults, salt sections, H₂S at concentrations greater than or equal to 100 ppm.

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 3462 with 32 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 2603 ft. with 31 sacks. Leave at least 100 ft. in casing 2533 CICR Depth

Perforate and squeeze at 1496 ft. with 31 sacks. Leave at least 100 ft. in casing 1446 CICR Depth

Perforate and squeeze at 809 ft. with 140 sacks. Leave at least 100 ft. in casing 759 CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set 20 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Shannon Chollett

Title: OWP Engineer

Date: _____

Email: shannon.chollett@state.co.us

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

<u>COA Type</u>	<u>Description</u>

Attachment List

<u>Att Doc Num</u>	<u>Name</u>
402568743	WELLBORE DIAGRAM

Total Attach: 1 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)