



## Daily Operations

**Well Name: DIETRICH RC07-01**

**Daily Operations**

Well Name	API	Job Type	Start Date	Summary
DIETRICH RC07-01	05-123-13183	PLUG AND ABANDON	5/13/2019	Haul pump and tank from Wright Goin 7-28 @ 1 hour, Select moved frac tank from Wright Goin 7-28 @ 1 hour. Select hauled 2 -130 bbls of water from town for a total of 230 bbls to start the job. Select layed hardline from pump and tank to wellhead @ 2.5 hours. The rig will kill the well when it arrives on location.
DIETRICH RC07-01	05-123-13183	PLUG AND ABANDON	5/15/2019	TUBING- 6:30 - 7:00, SAFETY MEETING SICP 400 PSI SITP 400 PSI BRADING HEAD 0 PSI, PUMP 40 BBLS WATER DOWN CSN & 20 BBLS DOWN TBN, 7:00 -8:00 RU RIG & EQUIP, 8:00 -9:00 ND WELL HEAD, NU BOP, PT BOP 2000 PSI F 15 MIN, LOW 250 F 15 MIN (GOOD TEST)9:00 -10:00 TOOH TALLY OUT 60 STDS 2 3/8 TBN, 10:00 -13:30 LD 102 JTS 2 3/8 4.7# J-55 TBN (TIGHT PIPE) 13:30 -14:00 SPOT IN WIRE LINE, RIH w/ GAGE RING, RIH w/ CIBP & SET @ 6770' , PT PLUG TO 1000 PSI F 15 MIN (GOOD TEST),RIH w/ BAILER & DUMP 2 SKS ON CIBP. 17:00 - 17:30 RD WIRE LINE, SIW, SDFN, 17:30 TRAVEL TO YARD
DIETRICH RC07-01	05-123-13183	PLUG AND ABANDON	5/15/2019	WIRELIN- PJSM, R/U rih with caliper @ 3.625 good run, RIH with CIBP ( Lost Boys ) set @ 6770' RIH with Bailer 2 sacks on top of CIBP, Pressure test @ 1000# Will shoot lower holes and Set CICR in the am
DIETRICH RC07-01	05-123-13183	PLUG AND ABANDON	5/16/2019	TUBING- 6:30 -7:00 SAFETY MEETING, SICP 80 PSI BLOW DOWN, 7:00 -8:00 RU WIRE LINE, RIH w/PERF GUNS & SHOOT SQUEEZE HOLES @ 4000,3700', 8:00 - 9:00 RIH w/ CICR & SET @ 3730',9:00 -10:30 RD WIRE LINE & TIH w/ STINGER TO 3730; 10:30 -11:00 PT TBN TO 1000 PSI F 15 MIN, RU HALIBERTON, 11:00 -12:00 PT LINES T 3000 PSI, PUNP 4 BBLS, PUMP 80 SKS, DISPLACE 12.5 SKS, STING OUT OF CICR LEAVING 2 SKS ON TOP OF PLUG, TOP OF CEMENT IN THE ANULIOUS 3772' INSIDE CSN 3550' RD HALIBURTON, 12:00 -13:30 LD 124 JTS 2 3/8 4.7# J-55 TBN TOTAL ON PIPE TRAILER 222 JTS;13:30 - 14:30 RD RIG FLOOR, ND BOP, NU FRAC VALVE, 14:30 -15:00RD RIG & EQUIP, 15:001530 ROAD RIG TO NEW LOCATION 15:30 -17:00 SPOT BASE BEAM & RIG17:00 -17:30 SIW SDFN ,18:00 TRAVEL TO THE YARD
DIETRICH RC07-01	05-123-13183	PLUG AND ABANDON	5/16/2019	PJSM, R/U RIH and shoot holes @ 4000' and 3700' No issues, RIH and Set CICR (Screaming Bull) @ 3730 Due to Collar @ 3740' R/D and Move out to shoot holes on Gemini UPRR C7-3, Wait On CMT, MIRU and prep For runs, RIH shots fired @ 2500' and 2190' Due to collar RIH with CICR Set @ 2240' POOh and R/D and M/O
DIETRICH RC07-01	05-123-13183	PLUG AND ABANDON	5/17/2019	HELD SAFETY MEETINNG W/ ALL VENDORS. RI HALLIBURTON & ND CT LUBRICATOR W/ 4.5" SCREAMING BULL STINGER W/ 3.65 OD GAUGE RING & 4' 2 3/8 SUB W/ KLX 3.60 OD CENTRALIZER, PSI TEST SURFACE LINES TO 3000 K, GOOD TEST, RI 4.5" CSG W/ 1 1/2" CT & BHA, TAG CICR @ 2240', POOH TO 2235'. PUMP FW @ .5 BPM & 300 PSI, HAD GOOD PSI SPIKE AT 2240'. SET 4K OVER CT WEIGHT AND STABBED INTO RETAINER. SD FOR WEATHER. PUMP 86 SKS (21 BBLS) PLUGCET @ 14.5# 1.39 FT3/SK, 6.77 GAL/SK, THROUGH PERFS @2500' TO 2190' & SD. POOH TO 2235' TO STING OUT OF CICR & PUMP, 10 SKS (2.5 BBLS) PLUGCET @ 14.5# 1.39 FT3/SK, 6.77 GAL/SK, ON TOP OF CICR. POOH W/ CT & BHA, SECURE WH RDMO. TURN OVER WELL TO W/L.
DIETRICH RC07-01	05-123-13183	PLUG AND ABANDON	5/20/2019	PJSM, Move in rig up, (very muddy conditions) RIH with Gun to shoot top shot @ 488' alls good and shots fired @ 488' 6SPF RDMO
DIETRICH RC07-01	05-123-13183	PLUG AND ABANDON	5/21/2019	HELD SAFETY MEETINNG W/ ALL VENDORS. RI HALLIBURTON CEMENT TO WH, PSI TEST SURFACE LINES TO 3000 K, GOOD TEST, PUMP 10 BBLS MUDFLUSH @ 3 BPM & CIRC 20 BBLS FW , PUMP 210 SKS (43 BBLS) G NEAT @ 15.8# 1.15 FT3/SK, 5.0 GAL/SK, DOWN CSG TO PERFS @ 488, W/ CEMENT RETURS AT SC, SD & SI WH. FLUSH SURFACE LINES TO WORKING TANK. SECURE WH, RDMO.