

FORM

6

Rev
11/20

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402801813

Date Received:

09/09/2021

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: Callie Fiddes

Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP

Phone: (720) 929-4361

Address: P O BOX 173779

Fax:

City: DENVER State: CO Zip: 80217-

Email: Callie_Fiddes@Oxy.com

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-23266-00

Well Name: WEBBER

Well Number: 17-3

Location: QtrQtr: NWNE Section: 3 Township: 3N Range: 66W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.257630

Longitude: -104.759230

GPS Data: GPS Quality Value: 3.1 Type of GPS Quality Value: PDOP Date of Measurement: 04/13/2006

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 1500Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7299	7314			
NIOBRARA	7074	7084			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	582	410	582	0	VISU
1ST	7+7/8	4+1/2	I80	11.6	0	7456	705	7456	3704	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6980 with 2 sacks cmt on top. CIBP #2: Depth 4020 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 110 sks cmt from 1500 ft. to 1304 ft. Plug Type: OPEN HOLE Plug Tagged: ☒
Set 75 sks cmt from 250 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 120 sacks half in. half out surface casing from 685 ft. to 532 ft. Plug Tagged: ☐

Set 75 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Prior to commencing operations, KMG will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

Courtesy notifications will be sent to all parcel owners within 1,500 feet of the location letting them know about our plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

Please delete attachment doc #402801825

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Callie Fiddes

Title: Regulatory Analyst Date: 9/9/2021 Email: Callie_Fiddes@Oxy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Haverkamp, Curtis Date: 9/17/2021

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 3/16/2022

Condition of Approval

COA Type

Description

	<p>1) Operator will implement measures to capture, combust, or control emissions to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public health, welfare and the environment. Due to proximity of building units (BUs) all blowdown gases will be controlled.</p> <p>2) Prior to commencing operations, at a minimum, the operator will provide an informational sheet to the owners/occupants of BUs that are adjacent to the parcel on which the well is located. The sheet will include the operator's contact information and the nature, timing, and expected duration of the plugging and abandonment (PA) operations.</p>
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p>
	<p>1) Provide 2 business day notice of plugging MIRU via electronic Form 42.</p> <p>2) After placing the shallowest hydrocarbon isolating plug (4020'), operator must wait a sufficient time to confirm static conditions.</p> <p>3) After placing plug at 1500' assure that all fluid migration has been eliminated by monitoring the well for a minimum of 8 hours before proceeding to the next plug. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.</p> <p>4) Prior to placing the 685' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>5) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 532' or shallower and provide at least 10 sx plug at the surface.</p> <p>6) Leave at least 100' of cement in the wellbore for each plug.</p> <p>7) Properly abandon flowlines as per Rule 1105. Pursuant to Rule 911.a. Closure of Oil and Gas Facilities, Operator will submit Site Investigation and Remediation Workplans via Form 27 for COGCC prior approval before cutting and capping the plugged well, conducting flowline abandonment, and removing production equipment. Pursuant to Rule 1105.f. Abandonment Verification, within 90 days of an operator completing abandonment requirements for a flowline or crude oil transfer line, an operator must submit a Field Operations Notice, Form 42-Abandonment of Flowlines for on-location flowlines, and a Flowline Report, Form 44, for off-location flowlines or crude oil transfer lines.</p> <p>8) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p>

3 COAs

Attachment List

Att Doc Num

Name

402801813	FORM 6 INTENT SUBMITTED
402801820	PROPOSED PLUGGING PROCEDURE
402806011	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	In accordance with the Notice to Operators (NTO): Timing for COGCC Forms adopted on 05/01/2020, this Form 6 Notice of Intent to Abandon is valid for 12 months from the date of approval. This NTO does not alter the deadlines for submission of, or compliance with any other Commission rule or Form.	09/17/2021
Engineer	DWR base of Fox Hills: 342' Deepest water well within 1 mile: 500'	09/17/2021
Permit	-Confirmed as-drilled location. -No other forms in process. -Production reporting up-to-date. -Cannot confirm productive interval, according to docnum: 400159795, the Codell interval is from 7299-7314. -Returned to draft.	09/09/2021
Permit	-Operator corrected. -Pass.	09/09/2021

Total: 4 comment(s)