

FORM
INSPRev
X/20State of Colorado
Oil and Gas Conservation Commission1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

11/01/2021

Submitted Date:

11/04/2021

Document Number:

696203346

FIELD INSPECTION FORM

 Loc ID 335950 Inspector Name: Trujillo, Aaron On-Site Inspection 2A Doc Num:
Operator Information:

OGCC Operator Number: 10433

Name of Operator: LARAMIE ENERGY LLC

Address: 1001 17TH STREET #1900

City: DENVER State: CO Zip: 80202

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Findings:

3 Number of Comments

1 Number of Corrective Actions

-
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE**Contact Information:**

Contact Name	Phone	Email	Comment
, Laramie		cogccnotifications@laramie-energy.com	All Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
335950	LOCATION	AC			-	CC 0697-16A2 Pad	RI

General Comment:

On 11/1/2021 Reclamation Specialist Trujillo conducted a stormwater inspection at Laramie Energy's CC 0697-14A2 Pad location in Garfield County, Colorado.

The inspection is a followup to #696203158 to document compliance with the following corrective actions:
1002.f: Stormwater

It was observed that the Location remains out of compliance with COGCC Rules and corrective actions.

Refer to the "Stormwater" section of this inspection report for additional details.

Refer to the photo-documentation of the observed compliance issues attached to this report.

Any corrective action(s) from previous inspections that have not been addressed are still applicable.

A follow up inspection on this site will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.

Inspected Facilities

Facility ID: 335950 Type: LOCATION API Number: - Status: AC Insp. Status: RI

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: Inspection #696203158 observed gully erosion due to stormwater runoff from the Location, on the north end of the site; stormwater and erosion control measures inadequate to control runoff from the Location in a manner that minimizes erosion and site degradation per good engineering practices.

It was observed in this inspection that work to repair/stabilize gully erosion and address runoff from the Location is inadequate; Operator has installed erosion logs into the gully erosion; velocity checks alone insufficient to manage runoff from the Location, to allow for proper stormwater discharge, and to minimize erosion degradation per good engineering practices. Additional erosion degradation and sediment transport is evident at the gully.

Corrective Action: Original corrective action and date remains applicable.
Comply with Rule 1002.f

Date: 09/21/2021

Pits: NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
402862664	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5572642
696203347	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5572632