

FORM
6Rev
11/20

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402887297

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: Evins, Bret

Tel: (970) 420-6699

COGCC contact:

Email: bret.evins@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-25202-00

Well Name: Cockroft

Well Number: 41-19

Location: QtrQtr: NENE Section: 19 Township: 5N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.390369

Longitude: -104.471927

GPS Data: GPS Quality Value: 1.7 Type of GPS Quality Value: Date of Measurement: 06/03/2014

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☒ Other Emergency P&A Wellhead ImpactCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6305	6583			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	415	330	415	0	VISU
1ST	7+7/8	4+1/2	J-55	11.6	0	6734	862	6734	0	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6255 with 2 sacks cmt on top. CIBP #2: Depth 2750 with 2 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 110 sks cmt from 1450 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Number of Days from Setting Surface Plug
 Surface Plug Setting Date: _____ Cut and Cap Date: _____ to Capping or Sealing the Well: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Cockroft 41-19 (05-123-25202)/Plugging Procedure (Intent)
 Producing Formation: Niobrara/Codell – 6305'-6583'

Temporarily Abandoned Formations: N/A

Upper Pierre Aquifer: 450'-1350'

TD: 6780' PBD: 6718' (11/1/16)

Surface Casing: 8 5/8" 24# @ 415' w/ 330 sxs cmt

Production Casing: 4 1/2" 11.6# @ 6734' w/ 862 sxs (TOC @ Surface – CBL)

Other in Hole: N/A

Tubing: 2-3/8" tubing @ 6657 (11/1/16)

Proposed Procedure:

1. MIRU. POOH 2-3/8" tubing
2. RU wireline
3. TIH with CIBP. Set BP at 6255'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Niobrara/Codell perms @ 6308')
4. TIH with CIBP. Set BP at 2750'. Top with 2 sxs 15.8#/gal CI G cement. (Courtesy plug)
5. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations.
6. TIH with tubing to 1450'. Mix and pump 110 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface. (Pierre coverage from 1450'-Surface)
7. Well casing cut and capped per COGCC guidelines at a depth as not to interfere with soil cultivation

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Jenifer Hakkarinen

Title: Reg Tech

Date: _____

Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

--	--

Attachment List

Att Doc Num

Name

402887298	WELLBORE DIAGRAM
402887299	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)