

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:

402894232

Date Received:

12/13/2021

FIR RESOLUTION FORM

Overall Status: CAC

CA Summary:

1 of 1 CAs from the FIR responded to on this Form

1 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 10706

Name of Operator: D90 ENERGY LLC

Address: 952 ECHO LANE SUITE 480

City: HOUSTON State: TX Zip: 77024

Contact Name and Telephone:

Name: _____

Phone: () _____ Fax: () _____

Email: _____

Additional Operator Contact:

Contact Name

Phone

Email

Boyer, David

303-994-0000

david@d90energy.com

Rikki Ross

Rikki@d90energy.com

Annalee Penner

417-773-2341

Annalee@fulcrumef.com

COGCC INSPECTION SUMMARY:

FIR Document Number: 689806700

Inspection Date: 12/02/2021

FIR Submit Date: 12/07/2021

FIR Status: _____

Inspected Operator Information:

Company Name: SANDRIDGE EXPLORATION & PRODUCTION LLC

Company Number: 10598

Address: 123 ROBERT S KERR AVE

City: OKLAHOMA CITY State: OK Zip: 73102

LOCATION - Location ID: 434014

Location Name: HEBRON CENTRAL FACILITY Number: 434014 County: _____

Qtrqr: SWNE Sec: 7 Twp: 7N Range: 80W Meridian: 6

Latitude: 40.593875 Longitude: -106.414203

FACILITY - API Number: 05-057- -00 Facility ID: 434014

Facility Name: HEBRON CENTRAL FACILITY Number: 434014

Qtrqr: SWNE Sec: 7 Twp: 7N Range: 80W Meridian: 6

Latitude: 40.593875 Longitude: -106.414203

CORRECTIVE ACTIONS:

1 ☒ CA# 158404

Corrective Action: Immediately cease venting.

Date: 12/03/2021

Response: CA COMPLETED

Date of Completion: 12/08/2021

Operator Comment: Tanks were immediately inspected with an LDAR camera upon notification (afternoon of 12/3/21). Tank volumes and weather had changed since the COGCC inspection and the leak was unable to be identified. D90 coordinated with the COGCC inspector to identify problematic tank. At 0815 on 12/8/21, venting was identified and determined to be a result of a failing thief hatch spring. The entire thief hatch was immediately replaced with

an Enardo thief hatch assembly, the tanks pressurized, and an LDAR inspection at 1040 indicated the leak has been stopped. Additional Enardo units have been ordered and will be replaced on all tanks at the location.

COGCC Decision: Approved pending re-inspection

COGCC
Representative:

OPERATOR COMMENT AND SUBMITTAL

Comment: The facility's last LDAR inspection on 9/29/21 did not identify any leaks. All thief hatch seals were replaced on 1/18/21 as preventative maintenance.

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Max Moran

Signed: _____

Title: Project Manager

Date: 12/13/2021 2:46:37 PM

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

Document Number **Description**

402894232	FIR RESOLUTION SUBMITTED
-----------	--------------------------

Total Attach: 1 Files