

FORM
6Rev
11/20

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Replug By Other Operator

Document Number:

403008959

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10651

Contact Name: Brian Stanley

Name of Operator: VERDAD RESOURCES LLC

Phone: (435) 6406426

Address: 1125 17TH STREET SUITE 550

Fax:

City: DENVER State: CO Zip: 80202

Email: bstanley@verdadresources.com

For "Intent" 24 hour notice required,

Name: Revas, Robbie

Tel: (720) 661-7242

COGCC contact:

Email: robbie.revas@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-05079-00

Well Name: BERGLUND

Well Number: 1

Location: QtrQtr: NWNW Section: 19 Township: 2N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: TAMPA

Field Number: 80830

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.129336

Longitude: -104.487717

GPS Data: GPS Quality Value: 2.2 Type of GPS Quality Value: PDOP Date of Measurement: 04/03/2022

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☒ Other Re-enter to re-plugCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7392	7402	09/07/1967	CEMENT	7319

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	13+1/2	9+5/8	j55	29.3	0	205	125	205	0	VISU
2ND	7+7/8	4+1/2	j55	9.5	5825	7450	150	7450	6762	CALC

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set	90	sks cmt from	5820	ft. to	5600	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input checked="" type="checkbox"/>
Set	40	sks cmt from	2500	ft. to	2400	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input checked="" type="checkbox"/>
Set	45	sks cmt from	1560	ft. to	1450	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input checked="" type="checkbox"/>
Set	90	sks cmt from	875	ft. to	675	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input checked="" type="checkbox"/>
Set	_____	sks cmt from	_____	ft. to	_____	ft.	Plug Type:	_____	Plug Tagged:	<input type="checkbox"/>

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 125 sacks half in. half out surface casing from 265 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

1. Provide 48 hr notice Form 42 to COGCC prior to rig up per Form 6 COA
2. Familiarize all personnel with allowed access to location and areas allowed to be disturbed.
3. Secure permission to access area and identify prospective well locations via satellite and survey data.
4. Verify well location and excavate well.
5. Once permission to begin work is secure, excavate area around well to sufficient size for safe access of casing, Verify casing size, cut off cap, weld on slip collar w/ wellhead and riser, set cellar ring and back-fill.
6. MIRU WO Rig, beam, doghouse, BOP, accumulator, rig pump, shaker tank, rig tank, 9.5ppg water-based mud, pipe float, 3-1/8" collars, 2-7/8" EUE work string, power swivel.
7. Make up BHA; 2 7/8 EUE string, 2x 3-1/8" drill collars, Float, POBS, 6.5" roller-cone bit.
8. RIH and drill out cement plugs from 0-35', and 180'-230'
9. Wash/Ream in 7-7/8" Open Hole to the cut-off casing at 5,825'. DO NOT DRILL ON CASING.
10. Circulate and condition hole.
11. TOOH, Laydown BHA.
12. RIH w/ 3-3/4" Tricone mill, XO, string float and wash/ream to top of casing.
13. MIRU cementers and pump 90sx 15.8ppg Class G Neat Cement from 5825'-5600'. Cement MUST be brought to at least 5600'. Displace and POOH through cement. Release cementers.
14. WOC 4 hours or otherwise advised by cementers and tag cement. If not tagged at or above 5600', contact engineer. May require additional cement.
15. POOH to 2500', circulate and condition hole. MIRU cementers and pump 40sx Class G Neat Cement from 2500'-2400'. Displace and POOH through cement.
16. WOC 4 hours or otherwise advised by cementers and tag cement. If not tagged at or above 2400', contact engineer. May require additional cement.
17. POOH to 1560', circulate and condition hole. MIRU cementers and pump 45sx Class G Neat cement from 1560'-1450'. Displace and POOH through cement.
18. WOC 4 hours or otherwise advised by cementers and tag cement. If not tagged at or above 1450', contact engineer. May require additional cement.
19. POOH to 875', circulate and condition hole. MIRU cementers and pump 90sx Class G Neat cement from 875'-675'. Displace and POOH through cement.
20. WOC 4 hours or otherwise advised by cementers and tag cement. If not tagged at or above 675', contact engineer. May require additional cement.
21. POOH to 265', circulate and condition hole. MIRU cementers and pump cement until returns taken to surface (125sks prescribed). Once good returns taken, SD cement and POOH. Top off as necessary.
22. RDMO Cementers, Rig, and supporting equipment. Tidy location and prep for reclamation.
23. After 5 days, verify TOC is within 5' of surface. Top off if needed. Excavate cellar ring and wellhead, cut off casing 6' below ground level and weld on cap with full legal description welded onto plate. Back fill hole.
24. Reclaim location.
25. Submit Form 6 Subsequent and Form 42 for completion of COA.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Brian Stanley
 Title: Completion Engineer Date: _____ Email: bstanley@verdadresources.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

COA Type	Description

Attachment List

Att Doc Num	Name
403011174	SURFACE OWNER CONSENT
403011176	LOCATION PHOTO
403011188	WELLBORE DIAGRAM
403011191	WELLBORE DIAGRAM
403011194	PROPOSED PLUGGING PROCEDURE

Total Attach: 5 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)