

# Inspection Photos and Issue Report

6/07/2022

Operator: GORDON ENGINEERING INC

#34720

Location ID: 312560

Mesa County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos  
Operator Name: GORDON ENGINEERING INC #34720  
Location ID: 312560



June 7, 2022  
39.22683745N 108.23916253W



June 7, 2022  
39.22684339N 108.23915583W

**Photo 1:** Photos taken from the west end of the Location, facing northeast and east. Photos provide an overview of the Location. Photos shows cheatgrass has established throughout the entire Location. Photo shows final reclamation has not been completed; work including, but not limited to, compaction alleviation (cross ripping to a minimum depth of 18 inches), recontouring /regrading and reclamation

Inspection Photos  
Operator Name: GORDON ENGINEERING INC #34720  
Location ID: 312560



**Photo 2:** Photos show fill slopes remaining; location has not been recontoured and regraded

Inspection Photos  
Operator Name: GORDON ENGINEERING INC #34720  
Location ID: 312560



**Photo 3:** Photo shows compaction issues are evident; Location has not been decompacted.

Inspection Photos  
Operator Name: GORDON ENGINEERING INC #34720  
Location ID: 312560




**Photo 4:** Photos taken from the north end of the Location where Operator was documented discharging cement waste off-site during plugging operations; cement waste remains evident. Areas of the spill devoid of grass vegetation. Spill has not been cleaned/remediated, and area reclaimed.

Inspection Photos  
Operator Name: GORDON ENGINEERING INC #34720  
Location ID: 312560



**Photo 5:** Photo taken from the access road. Photo example showing access road has not been properly recontoured/regraded to the original relative grade, and to that of the reference. Yellow line represents top grade of the adjacent area. Shovel used for scale.

Inspection Photos  
Operator Name: GORDON ENGINEERING INC #34720  
Location ID: 312560

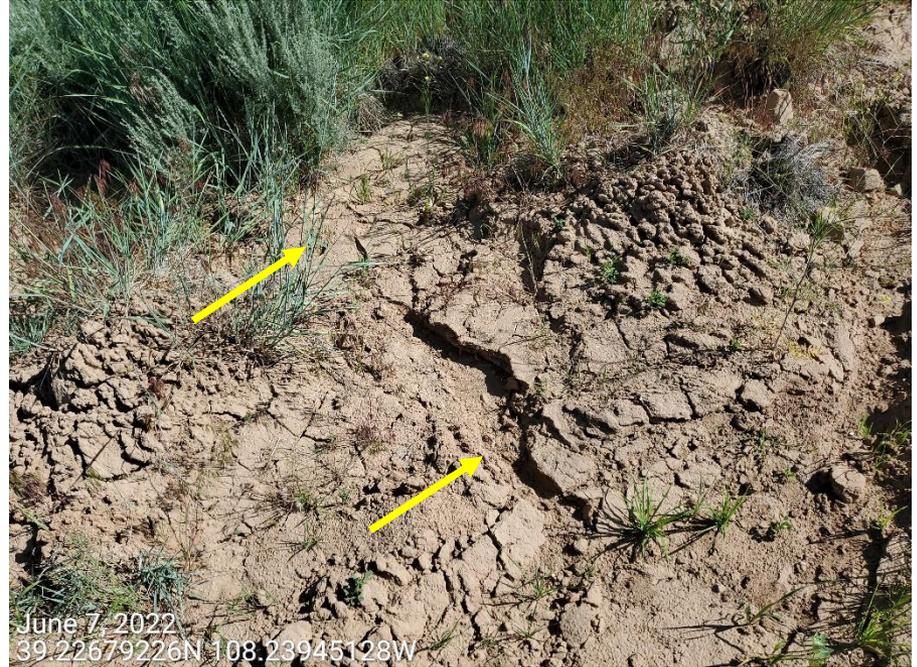

**Photo 6:** Photos provide examples of erosion degradation and sediment transport and deposition observed at access road. Stormwater and erosion control measures to minimize erosion, degradation and sediment transport at and from the access road remains missing or insufficient.