

FORM
6Rev
11/20

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

403084896

Date Received:

06/21/2022

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Santistevan, Brittani

Tel: (720) 471-1110

COGCC contact:

Email: brittani.santistevan@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-26738-00

Well Name: LEFFLER

Well Number: 44-35

Location: QtrQtr: SESE Section: 35 Township: 7N Range: 66W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: EATON

Field Number: 19350

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.526670

Longitude: -104.738140

GPS Data: GPS Quality Value: 1.6 Type of GPS Quality Value: PDOP Date of Measurement: 02/09/2010

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	7008	7312			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	899	630	899	0	VISU
1ST	7+7/8	4+1/2	J55	11.6	0	7458	172	7458	6634	CBL
S.C. 1.1						6634	730	6634	0	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6958 with 2 sacks cmt on top. CIBP #2: Depth 2500 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 125 sacks half in. half out surface casing from 1640 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Leffler 44-35 (05-123-26738)/Plugging Procedure (Intent)
Producing Formations: Niobrara/Codell: 7008'-7312'

Upper Pierre Aquifer: 450'-1540'

TD: 7469' PBTD: 7399' (11/05/2014)

Surface Casing: 8 5/8" 24# @ 899' w/ 630 sxs cmt

Production Casing: 4 1/2" 11.6# @ 7458' w/ 172 sxs (TOC @ 6634' - CBL)

S.C.1.1. @ 6634' w/ 730 sxs (TOC @ Surface - CBL)

Tubing: 2 3/8" tubing @ 7290 (11/05/2014)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.

2. RU wireline company.

3. TIH with CIBP. Set BP at 6958'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Nio perms @ 7008')

4. TIH with CIBP. Set BP at 2500'. Top with 2 sxs 15.8#/gal CI G cement.

5. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations.

6. TIH with tubing to 1640'. RU cementing company. Mix and pump 125 sxs 15.8#/gal CI G cement down tubing. (Pierre coverage from 1640' to Surface) Cement should circulate to surface.

7. Well casing cut and capped per COGCC guidelines at a depth as not to interfere with soil cultivation.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Valerie Danson

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE

Date: 7/8/2022

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 1/7/2023

Condition of Approval

COA Type

Description

	Prior to commencing operations, the operator will post signs in conspicuous locations at intersections that will remain in place throughout the duration of the plug and abandonment activities. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the applicable contact information. Signs will be placed so as not to create a potential traffic hazard.
	<p>1) Provide 2 business day notice of plugging MIRU via electronic Form 42, and provide 48 hours Notice of Plugging Operations, prior to mobilizing for plugging operations via electronic Form 42. These are 2 separate notifications, required by Rules 408.e and 408.l.</p> <p>2) After placing the shallowest hydrocarbon isolating plug (2500'), operator must wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact COGCC engineering before continuing operations.</p> <p>3) Prior to placing the 1640' plug: verify that all fluid migration (liquid and gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>4) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 849' or shallower and provide 10 sx plug at the surface.</p> <p>5) Leave at least 100' of cement in the wellbore for each plug.</p> <p>6) Properly abandon flowlines as per Rule 1105. Pursuant to Rule 911.a. Closure of Oil and Gas Facilities, Operator will submit Site Investigation and Remediation Workplans via Form 27 for COGCC prior approval before cutting and capping the plugged well, conducting flowline abandonment, and removing production equipment. Pursuant to Rule 1105.f. Abandonment Verification, within 90 days of an operator completing abandonment requirements for a flowline or crude oil transfer line, an operator must submit a Field Operations Notice, Form 42-Abandonment of Flowlines for on-location flowlines, and a Flowline Report, Form 44, for off-location flowlines or crude oil transfer lines.</p> <p>7) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed.</p>
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	<p>Prior to starting plugging operations a Bradenhead test shall be performed if there has not been a reported Bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p>
4 COAs	

Attachment List

<u>Att Doc Num</u>	<u>Name</u>
403084896	FORM 6 INTENT SUBMITTED
403084914	WELLBORE DIAGRAM
403084915	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
OGLA	OGLA review complete	07/07/2022
Engineer	1) Deepest Water Well within 1 mile = 100'. 2) Fox Hills Bottom- N/A, per SB5.	07/06/2022
Permit	Type of GPS Quality Value missing - added PDOP from the drop down box Verified as drilled lat/long - used Google Earth/COGIS mapping Verified completed intervals (Doc 12326738) Verified production reporting Review complete and task passed.	06/22/2022

Total: 3 comment(s)