

FORM

6

Rev  
11/20

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

403126273

Date Received:

08/15/2022

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: Lindsay Frase

Name of Operator: KERR MCGEE OIL &amp; GAS ONSHORE LP

Phone: (970) 515-1616

Address: P O BOX 173779

Fax:

City: DENVER State: CO Zip: 80217-

Email: Lindsay\_Frase@oxy.com

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-21312-00

Well Name: WARDELL

Well Number: 13-6

Location: QtrQtr: CSW Section: 6 Township: 3N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.250590 Longitude: -104.710840

GPS Data: GPS Quality Value: 2.5 Type of GPS Quality Value: Date of Measurement: 06/05/2006

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 815Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7390	7404			
NIOBRARA	7109	7280			

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	714	500	714	0	VISU
1ST	7+7/8	4+1/2	I-80	11.6	0	7544	435	7544	4120	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7050 with 2 sacks cmt on top. CIBP #2: Depth 260 with 80 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 5 sks cmt from 4539 ft. to 4475 ft. Plug Type: CASING Plug Tagged: ☐  
Set 55 sks cmt from 2800 ft. to 2100 ft. Plug Type: CASING Plug Tagged: ☐  
Set 55 sks cmt from 1800 ft. to 1100 ft. Plug Type: CASING Plug Tagged: ☐  
Set 80 sks cmt from 260 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Perforate and squeeze at 4569 ft. with 95 sacks. Leave at least 100 ft. in casing 4539 CICR Depth  
Perforate and squeeze at 2800 ft. with 165 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at 1800 ft. with 165 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 120 sacks half in. half out surface casing from 815 ft. to 664 ft. Plug Tagged: ☐

Set 80 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

#### BMPs

##### Signage for P&As:

Prior to commencing operations, KMG will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

##### Notifications:

Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about our plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

##### Wellbore Pressure:

In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.

##### Water:

Water will be placed on dirt access roads to mitigate dust as needed.

##### Lighting:

Operations are daylight-only; no lighting impacts are anticipated from operations.

##### Noise:

Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Lindsay Frase

Title: Regulatory Tech Date: 8/15/2022 Email: Lindsay\_Frase@oxy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Haverkamp, Curtis

Date: 8/18/2022

**CONDITIONS OF APPROVAL, IF ANY:**

Expiration Date: 2/17/2023

**Condition of Approval**

**COA Type**

**Description**

	<p>Consistent with Rule 911.a, a Form 27 must be approved prior to cut and cap, conducting flowline abandonment, or removing production equipment. Allow 30 days for Director review of the Form 27; include the Form 27 document number on the Form 44 for offsite flowline abandonment (if applicable) and on the Form 6 Subsequent.</p> <p>Properly abandon flowlines per Rule 1105. If flowlines will be abandoned in place, include with the Form 27: pressure test results conducted in the prior 12 months as well as identification of any document numbers for a COGCC Spill/Release Report, Form 19, associated with the abandoned line.</p>
	<p>1) Provide electronic Form 42 Notice of MIRU 2 business days ahead of operations and electronic Form 42 Notice of Plugging Operations 48 hours prior to mobilizing for plugging operations. These are two separate notifications, required by Rules 405.e and 405.l.</p> <p>2) Prior to placing the 815' plug: verify that all fluid (liquid and gas) migration has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump surface casing shoe plug. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 664' or shallower and provide a minimum of 10 sx plug at the surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug without mechanical isolation.</p> <p>5) With the Form 6 SRA operator must provide written documentation which positively affirms each COA listed above has been addressed.</p>
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p>

3 COAs

**Attachment List**

**Att Doc Num**

**Name**

403126273	FORM 6 INTENT SUBMITTED
403126278	PROPOSED PLUGGING PROCEDURE
403126279	WELLBORE DIAGRAM

Total Attach: 3 Files

### General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	DWR base of Fox Hills:567' Deepest water well within 1 mile:378'	08/18/2022
Permit	Returned to Draft per Operator's request	08/15/2022
OGLA	COA's provided by operator as BMP's listed in the technical detail/comments section. OGLA review complete.	08/12/2022
OGLA	Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.	08/12/2022
OGLA	Operations will be during daylight-only.	08/12/2022
OGLA	Water will be placed on dirt access roads to mitigate dust as needed.	08/12/2022
OGLA	Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about our plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.	08/12/2022
OGLA	Prior to commencing operations, KMG will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.	08/12/2022
Permit	Type of GPS Quality Value - missing - selected PDOP value from dropdown box Verified as drilled lat/long -Google Earth/COGIS Verified completed intervals (Docs 2556503, (653130, 501422)) Verified production reporting Review complete and task passed.	08/08/2022

Total: 9 comment(s)