

FORM

6

Rev  
11/20

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

402952406

Date Received:

02/09/2022

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Kevin Monaghan

Name of Operator: NOBLE ENERGY INC

Phone: (970) 3812990

Address: 2001 16TH STREET SUITE 900

Fax:

City: DENVER State: CO Zip: 80202

Email: kevin.monaghan@nblenergy.com

For "Intent" 24 hour notice required,

Name:

Tel:

COGCC contact:

Email:

 Type of Well Abandonment Report: ☐ Notice of Intent to Abandon ☒ Subsequent Report of Abandonment

API Number 05-123-13822-00

Well Name: TREBOR

Well Number: B11-2

Location: QtrQtr: NWNE Section: 11 Township: 5N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 56597

Field Name: KERSEY

Field Number: 44600

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.419280

Longitude: -104.514810

GPS Data: GPS Quality Value: 1.8 Type of GPS Quality Value: PDOP Date of Measurement: 03/02/2007

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes ☐ No Estimated Depth:Fish in Hole: ☐ Yes ☐ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☐ No If yes, explain details below

Details:

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6728	6740	11/23/2020	SAND PLUG	6395
NIOBRARA	6445	6645	11/23/2020	SAND PLUG	6395

Total: 2 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	NA	24	0	303	225	303	0	VISU
1ST	7+7/8	4+1/2	N80	15.1	0	6891	220	6891	5964	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6338 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 30 sks cmt from 2400 ft. to 2000 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 155 sacks. Leave at least 100 ft. in casing 2400 CICR Depth

Perforate and squeeze at 503 ft. with 313 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set 30 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: 503 ft. of 4+1/2 inch casing

Surface Plug Setting Date: 10/16/2021 Cut and Cap Date: 01/14/2022 Number of Days from Setting Surface Plug to Capping or Sealing the Well: 90

\*Wireline Contractor: SPN

\*Cementing Contractor: SPN

Type of Cement and Additives Used: Class G Neat

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☒ No

Technical Detail/Comments:

Procedure Email attached.  
COAs for production addressed.

Perfs @ 2500' and 2000' for CICR @ 2400'  
CSG Cut @ 503'  
30 sxs top off, no cmt ticket available for top off

Form 17 DocNum: 402849237  
Form 27 DocNum: 402880321  
Form 42 DocNum: 402831831  
Form 44 DocNum: Flowline will be abandoned.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Lauren Hoff  
Title: HSE Reg Affairs Coord Date: 2/9/2022 Email: DenverRegulatory@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Jacobson, Eric Date: 8/22/2022

CONDITIONS OF APPROVAL, IF ANY:

### Condition of Approval

**COA Type****Description**

0 COA
-------

### Attachment List

**Att Doc Num****Name**

402952406	FORM 6 SUBSEQUENT SUBMITTED
402952416	CEMENT JOB SUMMARY
402952417	OPERATIONS SUMMARY
402952418	OTHER
402952419	WELLBORE DIAGRAM
402952422	WIRELINE JOB SUMMARY

Total Attach: 6 Files

### General Comments

**User Group****Comment****Comment Date**

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)