

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

10/04/2022

Submitted Date:

10/05/2022

Document Number:

702500542**FIELD INSPECTION FORM**Loc ID 325489 Inspector Name: Klink, Alex On-Site Inspection ☐ 2A Doc Num: **Operator Information:**OGCC Operator Number: 10749Name of Operator: SIMCOE LLCAddress: 1199 MAIN AVE SUITE 101City: DURANGO State: CO Zip: 81301**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:5 Number of Comments2 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Telecky, Barbara		btelecky@blm.gov	Durango
Labowskie, Steve		steve.labowskie@state.co.us	
, General		sjninspections@ikavenergy.com	All SW field inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
214878	WELL	PR	03/01/2021	CBM	067-06482	PINE RIVER 04-32 1	PR

General Comment:

Inspector Alex Klink on site to conduct follow up inspection. Any corrective actions from previous inspections are still applicable. See link at end of report for inspection photos.

While accessing this location, several observations were made of stormwater impact along the access road. See below for a description and link at end of report for pictures. A collaborative effort should be made with the operator sharing this access road, Catamount Energy Partners, to repair these impacts. Erosion has exposed gathering pipeline along access road.

LocationOverall Good: ☐

Emergency Contact Number:

Comment: Corrective Action: Date: **Good Housekeeping:**

Type	WEEDS		
Comment:	Weeds within 25' of separator (IMG 06). Weeds within 25' of produced water tanks (IMG 07). CA date from previous inspection remains.		
Corrective Action:	Ensure within 25' of wellhead, tanks, and separators are free of combustible material per rule 610.k		Date: 09/07/2022

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Venting:**

Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities				
Facility ID: 214878	Type: WELL	API Number: 067-06482	Status: PR	Insp. Status: PR
Producing Well				
Comment:				
Corrective Action:				Date:

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: Erosion channels off of access road. Access road is not maintained (IMG 08, IMG 10, IMG 12, IMG 13). Sediment on access road, appears to be originating from up gradient. Drainage ditch is filled with sediment and not maintained (IMG 09, IMG 14). Sediment on access road which appears to be originating from up gradient, culvert inlet is buried, plugged, and unmaintained (IMG 11, IMG 15). Culvert has no outlet protection (IMG 17), erosion has exposed pipeline (IMG 13), and culverts are unmaintained. Access roads must be operated in a manner that minimizes erosion. This inspection was conducted ~48 hours after storm event, which is the CDPHE required time for self inspection and response.

Corrective Action: Install or repair/modify required BMPs per Rule 1002.f.(2)C, including culverts and ditches in order to minimize and control erosion and sediment migration.

Date: 11/04/2022

Pits: ☒ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
702500549	Photo doc	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5879104