

Graphic file not found  
(chevronlogo.png)

Well Name: THOMPSON C33-69HN  
UWI: 0512333589  
Job :ABANDON

Daily Operations	
Start Date	Summary
7/12/2022	<p>SAFETY MEETING SI CSG 350 PSI SI TBG 350 PSI SI BH 0 PSI</p> <p>RIG PUSHER CONDUCTED ROUTE SURVEY WITH PILOT CAR. JSA REVIEW WITH RIG CREW AND TRUCKERS. MIRU A-PLUS 7 FROM THE GITTLEIN, L 6-3. LAYDOWN FLOWLINES. ACCUMULATOR TEST, GOOD TEST, FUNCTION TEST BOPS. TEST BOPS 2 3/8" PIPE AND BLIND RAMS ON STUMP WITH HARD LINES AND 2 3/8" TIW. LOW/HIGH GOOD TESTS. RU RIG PUMP, CONTROL WELL PUMPED 260 BBL DOWN CSG. MONITOR WELL FOR BLOW/FLOW. START WORK CHECK ON RIGGING/LIFTING. ND TREE, UN-LAND TOP FLANGE, NU BOPS AND MUD-CROSS. RIG UP RIG FLOOR AND EQUIP. START WORK CHECK ON TUBULAR'S. TOOH W/105 JTS 2 3/8" TBG LEAVING 114 JTS 2 3/8" KILL STRING. SWI, SECURE LOCATION, SDFN</p> <p>EST RIG MOVE 7/14/22</p>
7/13/2022	<p>SAFETY MEETING SI CSG 0 PSI SI TBG 0 PSI SI BH 0 PSI</p> <p>START WORK CHECK ON TUBULARS. TOOH STANDBACK 34 JTS INTO DERRICK, LD 80 JTS. JSA REVIEW WITH RIG CREW AND W/L HAND. MIRU A-PLUS W/L. PU 7" CIBP AND SETTING TOOL. RIH W/ 7" CIBP. CORRELATE CCL TO COLLARS. SET CIBP @ 5944'. POOH, RIH W/ DUMP BAIL SPOT 2 SKS CMT ON TOP OF CIBP @ 5944'. LOAD WB W/ 160 BBL FW. PT @ 500 PSI 15 MIN. GOOD TEST. PU 7" CIBP AND SETTING TOOL. RIH W/ 7" CIBP. CORRELATE CCL TO COLLARS. SET CIBP @ 4082'. POOH, PU CBL, RIH TO 2600' AND LOG FROM 2600' TO SURFACE. POOH, RIH W/ DUMP BAIL SPOT 2 SKS CMT ON TOP OF CIBP @ 4082'. PU 7" CIBP AND SETTING TOOL. RIH W/ 7" CIBP. CORRELATE CCL TO COLLARS. SET CIBP @ 2505'. POOH, RIH W/ DUMP BAIL SPOT 2 SKS CMT ON TOP OF CIBP @ 2500'. POOH, RIG DOWN W/L. SWI, SECURE LOCATION, SDFN.</p> <p>EST RIG MOVE 7/14/22</p>
7/14/2022	<p>SAFETY MEETING SI CSG 0 PSI SI BH 0 PSI</p> <p>START WORK CHECK ON TUBULARS. TIH W/ 17 STDS 2 3/8" TBG, PU AND RIH W/ 1 JTS 2 3/8" TBG TO 1082' AND ESTABLISHED CIRCULATION. PUMPED 65 SKS CLASS G NEAT CMT BALANCED PLUG FROM 1082' TO 744'. POOH W/ TBG TO 500' AND REVERSED CLEAN. POOH W/ TBG. RIH W/ WL AND SHOT PERFS @ 200'. POOH W/ WL. CONFIRMED SHOTS FIRED. UNABLE TO CIRCULATE FORWARD OR REVERSE. CONSULTED ENGINEER AND MODIFIED PROCEDURE. APPROVED TO FIRE ADDITIONAL SET OF PERFS @ 100'. RIH W/ WL AND SHOT PERFS @ 100'. POOH W/ WL. CONFIRMED SHOTS FIRED. UNABLE TO CIRCULATE FORWARD OR REVERSE. PER MODIFIED PROCEDURE, PU AND RIH W/ 7 JTS 2 3/8" TBG. PUMPED 40 SKS CLASS G NEAT CMT FROM 100' TO SURFACE. ND BOP AND TOPPED OFF WELL W/ CMT TO SURFACE. SWI, RD. PLACE PTA TAG ON WELL. SECURE WELL. SDFN.</p> <p>DISPOSED 40 BBL TO NGL DISPOSED 130 BBL TO REPUBLIC</p> <p>EST RIG MOVE 7/15/22</p>