

**FORM  
INSP**Rev  
X/20**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

04/26/2023

Submitted Date:

04/28/2023

Document Number:

708300351**FIELD INSPECTION FORM**Loc ID 334269 Inspector Name: Morris, Matthew On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Operator Information:**OGCC Operator Number: 10770Name of Operator: VISION ENERGY LLCAddress: P O BOX 370City: IGNACIO State: CO Zip: 81137**Status Summary:**

- ☒
- THIS IS A FOLLOW UP INSPECTION
- 
- ☒
- FOLLOW UP INSPECTION REQUIRED
- 
- ☐
- NO FOLLOW UP INSPECTION REQUIRED

**Findings:**18 Number of Comments9 Number of Corrective Actions

- ☒
- Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Kellerby, Shaun		shaun.kellerby@state.co.us	
Byers, Jim		jbyers@blm.gov	
ENERGY, VISION		mco@visionenergy.biz	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
210984	WELL	SI	05/01/1996	CBM	045-06742	SOUTH SHALE RIDGE 1-8	SI
266868	WELL	SI	11/01/2007	CBM	045-09186	SOUTH SHALE RIDGE 1-8H	SI

**General Comment:****COGCC Inspection Report Summary**

On 4/26/2023 at approximately 13:30, Compliance Inspector Matthew Morris conducted a follow-up inspection at VISION ENERGY LLC, SOUTH SHALE RIDGE-68S98W/8NENE at Location ID #334269 in Garfield County, Colorado.

No corrective actions from FIR #708300180 have been completed. These corrective actions remain in effect.

During the inspection, the following compliance issues were observed:

- 1) Weeds on location have encroached on all production equipment
- 2) Unused equipment on location
- 3) No tank battery sign
- 4) Wellhead signs and tank labels contain inaccurate information
- 5) Weeds have compromised permeability of tank battery berms
- 6) No vehicle tracking BMP to prevent sediment migration
- 7) Gas meter calibration record not conspicuously posted

A follow-up on this site inspection will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules

This location is within or in close proximity to, a CPW Density/High Priority Habitat, Black Bear, NSO Habitat, and/or Wildlife Management area.

**Location**Overall Good: ☐**Signs/Marker:**

Type	BATTERY		
Comment:	No tank battery sign		
Corrective Action:	Install sign to comply with Rule 605.e	Date:	04/13/2023
Type	WELLHEAD		
Comment:	Inaccurate information on wellhead signs		
Corrective Action:	Install sign to comply with Rule 605.d	Date:	04/13/2023
Type	TANK LABELS/PLACARDS		
Comment:	Inaccurate information on tank labels/placards		
Corrective Action:	Install sign to comply with Rule 605.h	Date:	04/13/2023

**Emergency Contact Number:**

Comment: 911/(970) 858-8550

Corrective Action:

Date: \_\_\_\_\_

**Good Housekeeping:**

Type	UNUSED EQUIPMENT		
Comment:	Unused equipment on location		
Corrective Action:	Remove unused equipment to comply with Rule 606	Date:	03/28/2023
Type	WEEDS		
Comment:	Weeds have encroached entire production area		
Corrective Action:	Remove weeds from location to comply with Rule 606	Date:	03/20/2023

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Equipment:**

Type: Vertical Heated Separator	# 2		corrective date
Comment:			
Corrective Action:		Date:	
Type: Gas Meter Run	# 2		
Comment:	Gas meter calibration record not conspicuously posted		
Corrective Action:	Display legible gas meter calibration record in a conspicuous location to comply with Rule 430.d.(2)	Date:	05/08/2023
Type: Bradenhead	# 2		
Comment:	No form of pressure monitoring equipment located on Bradenheads. All Bradenhead valves are accessible.		
Corrective Action:		Date:	

Type: Bird Protectors	# 1		
Comment:			
Corrective Action:			Date:
Type: Pump Jack	# 2		
Comment:			
Corrective Action:			Date:

**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS	
PRODUCED WATER	1	300 BBLs	FIBERGLASS AST		,	
Comment:						
Corrective Action:						Date:

**Paint**

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

**Berms**

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Adequate	Walls Insufficient	Base Insufficient	Inadequate
Comment:	Weeds have compromised permeability and capacity of berm			
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 912.d.(1)			Date: 04/02/2023

Contents	#	Capacity	Type	Tank ID	SE GPS	
PRODUCED WATER	1	300 BBLs	Open Top		,	
Comment:						
Corrective Action:						Date:

**Paint**

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

**Berms**

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Inadequate	Walls Insufficient	Base Insufficient	Inadequate
Comment:	Weeds have compromised permeability and capacity of berm			
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 912.d.(1)			Date: 04/02/2023

**Venting:**

Yes/No	NO	
Comment:		
Corrective Action:	Date:	

**Flaring:**

Type		
Comment:		
Corrective Action:		Date:

**Inspected Facilities**Facility ID: 210984 Type: WELL API Number: 045-06742 Status: SI Insp. Status: SI**Idle Well**Purpose: ☒ Shut In ☐ Temporarily Abandoned Reminder: \_\_\_\_\_Comment: Last produced April 2010. Last MIT performed September 2021.

Corrective Action: \_\_\_\_\_ Date: \_\_\_\_\_

Facility ID: 266868 Type: WELL API Number: 045-09186 Status: SI Insp. Status: SI**Idle Well**Purpose: ☒ Shut In ☐ Temporarily Abandoned Reminder: \_\_\_\_\_Comment: Last produced April 2010. Last MIT performed September 2021.

Corrective Action: \_\_\_\_\_ Date: \_\_\_\_\_

**Reclamation - Storm Water - Pit****Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
		Other	Fail			Insufficient vehicle tracking BMPs
Compaction	Fail					Location lacks stabilization
Rip Rap						
Ditches						
Waddles	Fail					
Other	Fail					Insufficient vehicle tracking BMPs
		Compaction	Fail			Access road lacks stabilization
Sediment Traps						

Comment: 1) Location lacks stabilization with insufficient vehicle tracking BMPs in place to minimize transportation of sediment.  
2) Waddles on west side of pad are degraded and insufficient

Corrective Action: Oil and gas operators shall implement and maintain Best Management Practices (BMPs) at all oil and gas locations to comply with Rule 1002

Date: 03/20/2023

**Pits:** ☒ NO SURFACE INDICATION OF PIT

**Attached Documents**

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
708300352	Photo Log	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6097787">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6097787</a>