

Construction and Stormwater Inspection

May 31, 2023

Operator: BISON IV OPERATING LLC- 10670

Location ID: 477204

Inspection Document #: 697504684

Weld County, CO

NESE Section 29 T8N R61W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources



Photo 1. Drone imagery illustrates the location, facing Northeast. At the time of this inspection, there were no perimeter stormwater BMPs along the southern and western perimeter. The sediment basin overflowed and sediment laden stormwater discharged along the southwestern perimeter (red circle). Areas of sediment laden stormwater also discharged along the western perimeter (red arrows). Topsoil has been stockpiled along the southern location- green arrow.

Inspection Photos
Location Name: Ancona/Pad
Location ID: 477204



Photo 2. Photo taken from the southern location on the topsoil stockpile, facing North. Photo illustrates the stockpile has been temporarily stabilized; however, the equipment tracking was not conducted perpendicular to the slope.



Photo 3. Photo taken from the southern perimeter of location, facing West. Photo illustrates there is no perimeter stormwater BMP.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 697500020

Inspection Photos
Location Name: Ancona/Pad
Location ID: 477204



Photo 4. Photo taken from the sediment basin, facing North. Photo illustrates gully erosion is evident and in need of repair.



Inspection Photos
Location Name: Ancona/Pad
Location ID: 477204



Photo 5. Photo taken from the southwestern perimeter of location, facing South. See comments under Photo 3.



Photo 6. Photo taken from the northwestern perimeter of location, facing South. Photo illustrates a perimeter stormwater BMP that extends along the northern perimeter where there has been no oil and gas disturbance.

Inspection Photos
Location Name: Ancona/Pad
Location ID: 477204



Photo 7. Photo taken from the northwestern perimeter of location, facing East. See comments under Photo 6.



Photo 8. Photo taken from the northern perimeter of location, facing East. Photo illustrates the cut slope has temporarily stabilized; however, the equipment tracking was not conducted perpendicular to the slope.