

**FORM
INSP**

Rev
X/20

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

06/15/2023

Submitted Date:

06/22/2023

Document Number:

696205043

FIELD INSPECTION FORM

Loc ID: 484496 Inspector Name: Trujillo, Aaron On-Site Inspection: 2A Doc Num: _____

Status Summary:

THIS IS A FOLLOW UP INSPECTION

FOLLOW UP INSPECTION REQUIRED

NO FOLLOW UP INSPECTION REQUIRED

Findings:

6 Number of Comments

3 Number of Corrective Actions

Corrective Action Response Requested

Operator Information:

OGCC Operator Number: 10764

Name of Operator: NUEVIDA RESOURCES LLC

Address: 5950 CEDAR SPRINGS RD STE #100

City: DALLAS State: TX Zip: 75235

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
		dpate@nuevidaresources.com	
Costa, Ryan		ryan.costa@state.co.us	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
484496	LOCATION	AC	05/24/2023		-	Ardourel 33081718	CI

General Comment:

Due to technical difficulties, Reclamation Specialist Trujillo is submitting this inspection on behalf of Reclamation Specialist Costa. Please refer to the comments below, and the "Location Construction" section of this report:

On 6/15/2023, Ryan Costa conducted a construction inspection of the Ardourel 33081718 location.

6/26/2023- This inspection is being amended due to further review of the topsoil plan, and required topsoil salvage

See attached photos and additional details within this report.

Location Construction

Location ID: 484496 CDP: _____

Comment: The topsoil plan is only indicating that the top 6 inches will be salvaged for construction at both the Ardourel well and tank pad. Soil data and onsite evaluations indicate topsoil which should include A and B horizons extending down to 8"-10" at the Ardourel tank pad and 12"-14" at the Ardourel well pad. At the time of inspection topsoil was in process of being salvaged and stockpiled at the Ardourel tank pad and it appeared there was 6-8" being salvaged. A follow up inspection will be looking for at least 8"-10" at the tank pad and 12"-14" at the well pad.

Corrective Action: **Comply with 1002. b rules for soil removal and segregation** Date: **06/15/2023**

Form 2A COAs:

Comment: Construction activities was generating some dust due to windy day. There was a water truck onsite for dust mitigation which was not being utilized. Operator will need to implement dust mitigation measures and should also consider limiting construction operations on windy days.

Corrective Action: _____ Date: _____

Wildlife BMPs:

Comment: Per wildlife COA, "if construction is to be conducted between March 15th and August 31st, a migratory bird nest survey will be conducted before clearing and/or grubbing takes place."

Corrective Action: Provide documentation of migratory bird nest survey

Date: 06/28/2023

Stormwater:

Erosion BMPs	Present	Other BMPs	Present
	No		No

Comments: Erosion BMPs: None
Other BMPs: None

Corrective Action: _____ Date: _____

Comment: No stormwater controls were installed prior to construction. There was no vehicle tracking pad, culverts, perimeter ditch or other BMP observed per Permit Conditions of Approval or Operators Stormwater Management Plan. Operator was contacted day of inspection regarding missing stormwater controls and immediate corrective action. Corrective action is the day of inspection and the location will remain out of compliance until completed.

Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)

Date: 06/15/2023

On Site Inspection (305):

Surface Owner Contact Information:

Name: _____ Address: _____
Phone Number: _____ Cell Phone: _____

Operator Rep. Contact Information:

Landman Name: _____ Phone Number: _____
Date Onsite Request Received: _____ Date of Rule 306 Consultation: _____

Request LGD Attendance: _____

LGD Contact Information:

Name: _____ Phone Number: _____ Agreed to Attend: _____

Summary of Landowner Issues:

Summary of Operator Response to Landowner Issues:

Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

Inspected Facilities

Facility ID: 484496 Type: LOCATION API Number: - Status: AC Insp. Status: CI

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403442702	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6157709
403445186	Topsoil Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6160564
696205044	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6157684