

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

09/25/2023

Submitted Date:

09/25/2023

Document Number:

699107440

FIELD INSPECTION FORMLoc ID 329979 Inspector Name: Burns, Adam On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

OGCC Operator Number: 46290

Name of Operator: KP KAUFFMAN COMPANY INC

Address: 1700 LINCOLN ST STE 4550

City: DENVER State: CO Zip: 80203

Status Summary:

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:

8 Number of Comments

2 Number of Corrective Actions

☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
,		cogcc@kpk.com	All Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
329979	LOCATION	AC			-	HSR CHURCH-62N62W 17SESW	SI

General Comment:[Routine Inspection](#)

LocationOverall Good: ☐**Signs/Marker:**

Type	BATTERY		
Comment:			
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment: Adequate

Corrective Action:

Date: _____

Good Housekeeping:

Type	WEEDS		
Comment:	Overgrown Vegetation in multiple spots on location, needs to be removed for good housekeeping.		
Corrective Action:		Date:	
Type	OTHER		
Comment:	Stained soil in front of load out box. See attached photo		
Corrective Action:	"Properly dispose of oily waste in accordance with 905.e."	Date:	10/06/2023

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Equipment:**

Type: Gas Meter Run	# 1		corrective date
Comment:			
Corrective Action:		Date:	
Type: Horizontal Heated Separator	# 1		
Comment:			
Corrective Action:		Date:	
Type: Bird Protectors	# 1		
Comment:			
Corrective Action:		Date:	

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	100 BBLS	PBV FIBERGLASS		,
Comment:					

Corrective Action:		Date:	
--------------------	--	-------	--

Paint

Condition	
Other (Content)	
Other (Capacity)	
Other (Type)	

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Comment:				
Corrective Action:				
	Date:			

Contents	#	Capacity	Type	Tank ID	SE GPS
CRUDE OIL	1	300 BBLs	STEEL AST		40.132800,-104.348100
Comment:					
Corrective Action:					
	Date:				

Paint

Condition	Adequate
Other (Content)	
Other (Capacity)	
Other (Type)	

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Inadequate	Walls Insufficient	Base Sufficient	Inadequate
Comment:	Weathered Berms around the production tank. See attached photos.			
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 603.o			
	Date: 10/06/2023			

Venting:

Yes/No	NO
Comment:	
Corrective Action:	
	Date:

Flaring:

Type	
Comment:	
Corrective Action:	
	Date:

Inspected FacilitiesFacility ID: 329979 Type: LOCATION API Number: - Status: AC Insp. Status: SI**Idle Well**Purpose: ☒ Shut In ☐ Temporarily Abandoned

Reminder: _____

Comment: SI Tank Battery

Corrective Action: _____

Date: _____

COGCC Comments

Comment	User	Date
<p>ECMC Inspection Report Summary</p> <p>On Monday 9/25/23 at approximately 0924hrs I, Inspector Adam Burns, Conducted an on-site inspection at HSR CHURCH-62N62W 17SESW Tank Battery of KP Kaufman Company INC.</p> <p>Location ID #329979 in Weld County, Colorado.</p> <p>During this inspection the following possible compliance issues were observed:</p> <p>Overgrown Vegetation in multiple spots on location, needs to be removed for good housekeeping. Comply with Rule 606. With a Corrective Action date of 10/6/23</p> <p>Stained soil in front of load out box. "Properly dispose of oily waste in accordance with 905.e." With a Corrective Action date of 10/6/23</p> <p>Weathered Berms around the production tank. Repair or install berms or other secondary containment devices per Rule 603.o. With a Corrective Action date of 10/6/23</p> <p>A follow up on this site inspection needs to be conducted to ensure the compliance issues have been corrected to comply with ECMC rules.</p> <p>This is a summary of the inspection report.</p>	burnsa	09/25/2023

Attached DocumentsYou can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403540615	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6263360
699107441	Inspection photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6263344